



# Cable Preparation for compression

## For F Connector

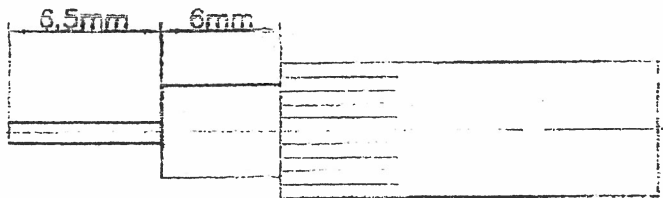

## For BNC Connector

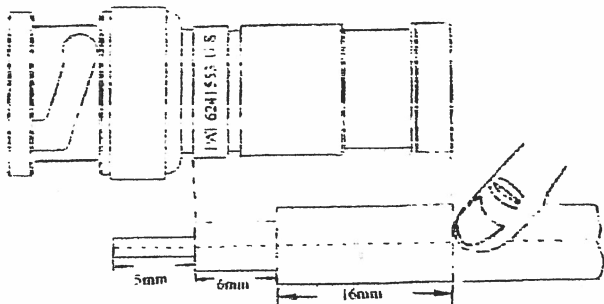

## connectors

- Expose 6.5 mm center conductor for F connector. (5 mm center conductor for BNC · RCA · · connectors). Remove 6mm of jacket to expose 6mm of braid and dielectric (Do not cut braid, or score center conductor)
- Fold exposed braid back over jack. Leave foil attached to dielectric.
- For Quad Shield Cable: Fold outer braid back over jack, remove outer foil, fold inner braid back over jacket.
- BNC · RCA · · are blind entry connectors that require a mark on the cable to insure proper cable insertion. The connector itself can be used as length guide. Using a pen or thumbnail to mark as shown below.

## For RCA Connector

