


Operating manual Analogue refractometer

KERN ORA 80 BE Analogue Expert 2x Brix scale

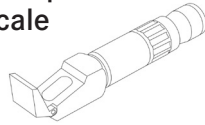

KERN & Sohn GmbH

Ziegelei 1
D-72336 Balingen
E-Mail: info@kern-sohn.com

Tel: +49-[0]7433-9933-0
Fax: +49-[0]7433-9933-149
Internet: www.kern-sohn.com

Version 1.2 04/2019


CONTENTS

1	Technical data.....	1
2	Description	2
3	General information	3
3.1	Intended use	3
3.2	Warranty	3
4	Basic safety information	4
4.1	Follow the instructions in the operating manual	4
4.2	Warning.....	4-5
5	Supplied items.....	5
6	Before the first use.....	6
7	Use/measurement.....	6
7.1	Zero point calibration	7-8
7.2	Additional advice	9
7.3	Measuring procedure	9-10
8	Cleaning and maintenance.....	11
9	Storage.....	11
10	Service	11
11	Disposal	12
12	Additional information.....	12
13	Brix to refractive index (nD) conversion table.....	13
14	Annex	14


1. Technische Daten

Models KERN	Measuring range and Scales	Scale graduations Accuracy	Dimensions Product	Net weight
ORA 80BE	Brix: 0-50% Brix: 50-80%	0,5 % Brix 0,5 % Brix	180x40x40mm	0,400kg


Example scale on
ORA 80 BE

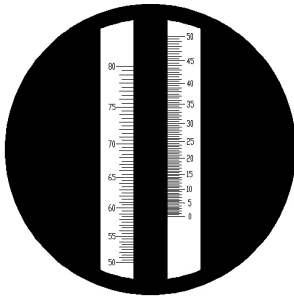

2. Description

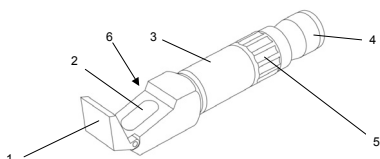

1. Prism cover
2. Prism surface
3. Optical tubes with grip
4. Eyepiece with diopter adjustment ring
5. Adjusting wheel measuring range
6. Adjusting screw

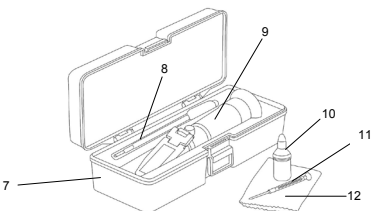

7. Storage box
8. Pipette
9. Refractometer
10. Calibration liquid (Distilled water)
11. Adjustment tool
12. Cleaning cloth

3. General information

3.1 Intended use

The refractometer is a measuring instrument for determining the refractive index of transparent substances in liquid or in some cases also in the solid state. It is used to observe the behaviour of light as it passes from a prism with known properties to the substance being tested.

Use of the refractometer for other purposes is contrary to its intended use and may be hazardous. The manufacturer shall not be liable for any damages caused by improper use.

3.2 Warranty

The warranty shall be void in the event of:

- Failure to observe the instructions in the operating manual
- Use for purposes other than those described
- Modifications or opening the device housing
- Mechanical damage and/or damage resulting from media, liquids, natural wear and tear

3

4. Basic safety information

4.1 Follow the instructions in the operating manual



- Carefully read through the operating manual even if you have prior experience with KERN refractometers.
- Every language version includes a non-authoritative translation. The original German document is the definitive version.

4.2 Warning

- Do not let acids come into contact with skin or eyes. If acid comes into contact with skin, flush with copious amounts of water. Shower if larger areas of skin are affected.
- If acid comes into contact with eyes, keep the eyelid open and flush the eye with running lukewarm water from the outer corner to the inner corner. Flush eyes for at least 15 minutes. Then consult a doctor or ophthalmologist immediately.
- Thoroughly clean the refractometer after each use.
- The refractometer must not be exposed to extreme temperatures, high mechanical stresses, strong direct sunlight or high humidity.
- This refractometer is not a toy. Keep out of reach of children.
- Make sure that you will not be hit by anything else while you are using the refractometer, as this could cause serious eye injuries
- The rubber eyeshade may cause irritation when in prolonged contact with the skin. If this happens, consult your doctor.
- Do not touch the lenses with your fingers.

4

5. Supplied items

After unpacking and before using the device for the first time, check that all listed parts have been supplied. Replace damaged or faulty parts immediately and do not put them into operation.

- Refractometer
- Storage box
- Pipette
- Adjustment tool
- Cleaning cloth
- Calibration liquid (Distilled water)

5

6. Before the first use

Remove the protective film (if present) from the prism surface [2] and check that the rubber eye-cup [4] is fitted correctly.

7. Use/measurement

The refractometer can be used to quickly and accurately determine the refractive index of transparent substances, liquid or solid ones. To ensure correct measurement, the measuring device should be adjusted before measurements are carried out. Please make sure your hands are dry before handling the measuring device.

The measuring instrument has two measuring ranges. To switch between the two measuring ranges rotate the housing ring [5] between the eyepiece [4] and the optical tube [3].



The refractometer cannot be used for the measurement of oil-based fluids.

7.1 Zero point calibration

- ▶ Hold up the refractometer against a sufficiently bright light source and look through the eyepiece [4], holding the eyepiece closely against your eye/glasses.
- ▶ Rotate the eyepiece [4] to adjust it for your eyesight, until you can see the scale sharply.
- ▶ Open the prism cover [1].
- ▶ Thoroughly clean the prism [2] and the underside of the prism cover [1] using a soft cloth or soft paper (with alcohol if necessary) and wipe dry. Water should only ever be applied to the measuring prism, not to other parts of the device.
- ▶ Now apply a few drops of the calibration liquid [10] onto the prism surface [2].
- ▶ close the prism cover [1]. The amount of fluid should be sufficient to moisten most of the prism surface. There should not be any air bubbles between the measuring prism [2] and prism cover [1].
- ▶ Wait about 30 seconds to allow the temperatures of the test fluid and prism to equalise.
- ▶ Look through the eyepiece [4] while pointing the refractometer's prism surface [2] at a bright light source.
- ▶ Through the eyepiece [4], you will see a bright and a blue field. The boundary line through the eyepiece [4].
- ▶ With the aid of the supplied adjustment tool [11] to turn the adjustment screw [3] at the side of the prism surface [2] the scale can be adjusted so that the measuring device is optimally set up by moving the boundary line upwards or downwards.
Calibration value: 0 % (Brix)
- ▶ For refractometers without automatic temperature compensation (ATC): Convert the measured value to take account of the deviation in room and sample temperature from +20 °C. (See the table at the end of this manual, Point 14.)
- ▶ Repeat step 4 (cleaning).

Important!

The ambient/room temperature and the sample temperature influence the refractometer measuring result.
The scales are designed for an ambient temperature of +20 °C!
If the measurements are carried out at a temperature other than +20 °C, the results must be correspondingly corrected.
A correction table can be found in the annex, Point 14.



8

7.2 Additional advice

It is important that the samples being measured are representative samples. Measurements should be carried out quickly on samples that evaporate easily. If possible, the samples should be at the same temperature as the measuring instrument in order to achieve an accurate result.

7.3 Measuring procedure

- ▶ Make sure your hands are dry before handling the refractometer.
- ▶ Open the prism cover [1] and use the supplied pipette [8] to apply a few drops of the sample liquid [8] onto the prism surface [2], then close the prism cover [1]. Spread the liquid evenly by pressing down on the prism cover [1] and eliminate any air bubbles present.
- ▶ Hold the device horizontally and wait about 30 seconds (for optimal temperature equalisation between the sample and device).
- ▶ View the measurement scale through the eyepiece [4]. Point the prism surface [2] of the refractometer at a bright light source while doing this.
- ▶ Rotate the adjustment ring [5] on the eyepiece [4] to adjust the focus.
- ▶ The boundary line will move on the measurement scale depending on the concentration. This bright/dark boundary line shows the result directly on the scale.
- ▶ If the temperature deviates from +20 °C, correct the measured result using the corresponding value from the temperature correction table [13].
- ▶ Carefully clean the supplied pipette [8] and the refractometer after carrying out the measurement.

Important!

After every measurement, use a lint-free, absorbent cloth to remove the fluids from the prism surface [2] and prism cover [1]. Then carefully clean the prism and prism cover using a cloth moistened with water and dry both parts using a soft, dry and lint-free cloth. Avoid rubbing the prism [2].



10

8. Cleaning and maintenance

Clean the refractometer using a soft, lint-free cloth moistened with water, or if necessary alcohol. Do not use any aggressive or abrasive cleaning agents. Never immerse the device in water or hold it under running water. Never handle the device with wet or damp hands.

Never touch the measuring prism [2] with hard tools made from plastic, wood, rubber, metal, glass etc. Hard objects can quickly damage the relatively soft prism glass, resulting in measurement errors.

The refractometer is maintenance-free.

Cleaning should be carried out immediately before and after each use of the refractometer to maximise its life and optimise measurement results.

9. Storage

Store the refractometer in a dry, non-corrosive environment, preferably between 10 °C and 30 °C.

10. Service

After reading this operating manual, if you have any questions about setting up or using the refractometer, or if any unexpected problem occurs, please contact your dealer. The device housing may only be opened by trained service technicians authorised by KERN.

11. Disposal

The packaging consists of environmentally friendly materials which can be disposed of via local recycling facilities.
The device and storage box should be disposed of by the operator in accordance with applicable national or regional regulations at the place of use.

12. Additional information

The product may differ slightly from the illustrations.
Avoid exposing the refractometer to direct sunlight.
Never bring the refractometer into contact with solvents.

13. Brix to refractive index (nD) conversion table

Data from „ICUMSA“ International Commission for Uniform Methods of Sugar Analysis, at 20 °C and 589 nm wavelength.

Refractive index	Brix	%	Refractive index	Brix	%	Refractive index	Brix	%	Refractive index	Brix	%
1.44193	60	1.44193	1.38115	30	1.38115	1.32399	0	1.32399	1.32399	0	1.32399
1.44420	61	1.44420	1.38296	31	1.38296	1.33442	1	1.33442	1.33442	1	1.33442
1.44650	62	1.44650	1.38478	32	1.38478	1.33586	2	1.33586	1.33586	2	1.33586
1.44881	63	1.44881	1.38661	33	1.38661	1.33732	3	1.33732	1.33732	3	1.33732
1.45113	64	1.45113	1.38846	34	1.38846	1.33879	4	1.33879	1.33879	4	1.33879
1.45348	65	1.45348	1.39032	35	1.39032	1.34026	5	1.34026	1.34026	5	1.34026
1.45584	66	1.45584	1.39220	36	1.39220	1.34175	6	1.34175	1.34175	6	1.34175
1.45822	67	1.45822	1.39409	37	1.39409	1.34325	7	1.34325	1.34325	7	1.34325
1.46061	68	1.46061	1.39590	38	1.39590	1.34476	8	1.34476	1.34476	8	1.34476
1.46303	69	1.46303	1.39772	39	1.39772	1.34629	9	1.34629	1.34629	9	1.34629
1.46546	70	1.46546	1.39956	40	1.39956	1.34782	10	1.34782	1.34782	10	1.34782
1.46792	71	1.46792	1.40141	41	1.40141	1.34937	11	1.34937	1.34937	11	1.34937
1.47037	72	1.47037	1.40328	42	1.40328	1.35093	12	1.35093	1.35093	12	1.35093
1.47285	73	1.47285	1.40516	43	1.40516	1.35250	13	1.35250	1.35250	13	1.35250
1.47535	74	1.47535	1.40706	44	1.40706	1.35408	14	1.35408	1.35408	14	1.35408
1.47787	75	1.47787	1.40896	45	1.40896	1.35566	15	1.35566	1.35566	15	1.35566
1.48040	76	1.48040	1.41081	46	1.41081	1.35725	16	1.35725	1.35725	16	1.35725
1.48295	77	1.48295	1.41265	47	1.41265	1.35881	17	1.35881	1.35881	17	1.35881
1.48552	78	1.48552	1.41450	48	1.41450	1.36054	18	1.36054	1.36054	18	1.36054
1.48811	79	1.48811	1.41635	49	1.41635	1.36218	19	1.36218	1.36218	19	1.36218
1.49071	80	1.49071	1.41819	50	1.41819	1.36384	20	1.36384	1.36384	20	1.36384
1.49333	81	1.49333	1.42009	51	1.42009	1.36551	21	1.36551	1.36551	21	1.36551
1.49597	82	1.49597	1.42192	52	1.42192	1.36720	22	1.36720	1.36720	22	1.36720
1.49862	83	1.49862	1.42378	53	1.42378	1.36889	23	1.36889	1.36889	23	1.36889
1.50129	84	1.50129	1.42562	54	1.42562	1.37060	24	1.37060	1.37060	24	1.37060
1.50398	85	1.50398	1.42749	55	1.42749	1.37233	25	1.37233	1.37233	25	1.37233
			1.42932	56	1.42932	1.37406	26	1.37406	1.37406	26	1.37406
			1.43117	57	1.43117	1.37582	27	1.37582	1.37582	27	1.37582
			1.43303	58	1.43303	1.37758	28	1.37758	1.37758	28	1.37758
			1.43487	59	1.43487	1.37936	29	1.37936	1.37936	29	1.37936

14. Annex

Table 1: International Temperature Correction Table for °Brix (% sugar gradient)
Correct the result by the following values (refractometer must be correctly calibrated at 20 °C).

Temperature °C	% Brix reading		10.0	15.0	20.0	25.0	30.0	35.0	40.0	45.0	50.0	55.0	60.0	65.0	70.0	75.0	80.0	85.0
	0.0	5.0																
10.0	-0.53	-0.56	-0.59	-0.62	-0.65	-0.67	-0.69	-0.71	-0.72	-0.73	-0.74	-0.75	-0.75	-0.75	-0.75	-0.75	-0.74	-0.73
11.0	-0.49	-0.52	-0.54	-0.57	-0.59	-0.61	-0.63	-0.64	-0.65	-0.66	-0.67	-0.68	-0.68	-0.68	-0.68	-0.67	-0.67	-0.66
12.0	-0.44	-0.47	-0.49	-0.51	-0.53	-0.55	-0.56	-0.57	-0.58	-0.59	-0.60	-0.61	-0.61	-0.61	-0.61	-0.60	-0.60	-0.59
13.0	-0.40	-0.41	-0.43	-0.45	-0.47	-0.48	-0.50	-0.51	-0.52	-0.52	-0.53	-0.53	-0.53	-0.53	-0.53	-0.52	-0.52	-0.52
14.0	-0.34	-0.36	-0.38	-0.39	-0.40	-0.42	-0.43	-0.44	-0.44	-0.45	-0.45	-0.45	-0.45	-0.45	-0.45	-0.45	-0.45	-0.44
15.0	-0.29	-0.31	-0.32	-0.33	-0.34	-0.35	-0.36	-0.37	-0.37	-0.38	-0.38	-0.38	-0.38	-0.38	-0.38	-0.38	-0.37	-0.37
16.0	-0.24	-0.25	-0.26	-0.27	-0.28	-0.28	-0.29	-0.30	-0.30	-0.31	-0.31	-0.31	-0.31	-0.31	-0.31	-0.30	-0.30	-0.30
17.0	-0.18	-0.19	-0.20	-0.20	-0.21	-0.21	-0.22	-0.22	-0.23	-0.23	-0.23	-0.23	-0.23	-0.23	-0.23	-0.23	-0.23	-0.22
18.0	-0.12	-0.13	-0.13	-0.14	-0.14	-0.14	-0.15	-0.15	-0.15	-0.15	-0.15	-0.15	-0.15	-0.15	-0.15	-0.15	-0.15	-0.15
19.0	-0.06	-0.06	-0.07	-0.07	-0.07	-0.07	-0.07	-0.08	-0.08	-0.08	-0.08	-0.08	-0.08	-0.08	-0.08	-0.08	-0.08	-0.07
20.0	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
21.0	0.06	0.07	0.07	0.07	0.07	0.07	0.08	0.08	0.08	0.08	0.08	0.08	0.08	0.08	0.08	0.08	0.08	0.07
22.0	0.13	0.14	0.14	0.14	0.15	0.15	0.15	0.16	0.16	0.16	0.16	0.16	0.16	0.16	0.15	0.15	0.15	0.15
23.0	0.20	0.21	0.21	0.22	0.22	0.23	0.23	0.23	0.23	0.24	0.24	0.24	0.24	0.23	0.23	0.23	0.23	0.22
24.0	0.27	0.28	0.29	0.29	0.30	0.30	0.31	0.31	0.31	0.32	0.32	0.32	0.32	0.31	0.31	0.31	0.30	0.30
25.0	0.34	0.35	0.36	0.37	0.38	0.38	0.39	0.39	0.40	0.40	0.40	0.40	0.40	0.39	0.39	0.39	0.38	0.37
26.0	0.42	0.43	0.44	0.45	0.46	0.46	0.47	0.47	0.48	0.48	0.48	0.48	0.48	0.47	0.47	0.46	0.46	0.46
27.0	0.50	0.51	0.52	0.53	0.54	0.55	0.55	0.56	0.56	0.56	0.56	0.56	0.56	0.55	0.55	0.54	0.53	0.52
28.0	0.58	0.59	0.60	0.61	0.62	0.63	0.64	0.64	0.64	0.65	0.65	0.64	0.64	0.64	0.63	0.62	0.61	0.60
29.0	0.66	0.67	0.68	0.69	0.70	0.71	0.72	0.73	0.73	0.73	0.73	0.72	0.72	0.71	0.70	0.69	0.68	0.68
30.0	0.74	0.75	0.77	0.78	0.79	0.80	0.81	0.81	0.81	0.82	0.81	0.81	0.81	0.80	0.79	0.78	0.77	0.75

11

12

13

14