LASER SENSORS PHOTOELECTRIC

MICRO PHOTOELECTRIC SENSORS AREA SENSORS

SAFETY COMPONENTS PRESSURE SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS WIRE-SAVING SYSTEMS MEASUREMENT SENSORS

STATIC CONTROL DEVICES LASER MARKERS

> Selection Guide

GXL GL GX-U / GX-FU / GX-N

Amplifierseparated GA-311 / GH

> Other Products

GX-F/H SERIES

FIBER SENSORS Related Information

General terms and conditions......P.1
Glossary of terms......P.1009~

Sensor selection guide.......P.11~ / P.647~ General precautions.......P.1012~











GX-□12


Previous

Industry No. 1* in stable sensing

* Based on research conducted by SUNX as of August 2007 among equivalent rectangular inductive sensors.

Can be installed with ample space


This sensor has the longest stable sensing range among the same level of rectangular inductive proximity sensors in the industry. It is easy to install the sensor.

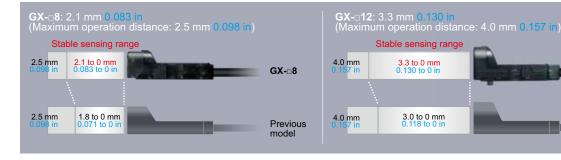

Variation at the maximum operation distance is within ±8 %

Thorough adjustment and control of sensing sensitivity greatly reduces individual sensor differences and variations.


The work of adjusting sensor positions when using multiple sensors and when sensors have been replaced is much easier.

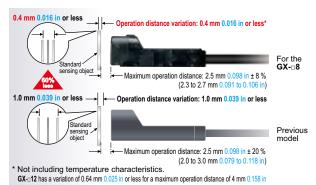

Temperature characteristics vary within ±8 %

Components such as the sensor coil and core and product design have been totally revised to provide excellent temperature characteristics.


Stable sensing can be obtained regardless of the time of day or the yearly season.

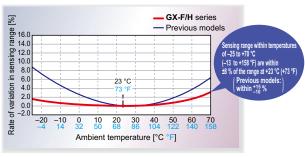


* Typical

SUNX

APPLICATIONS

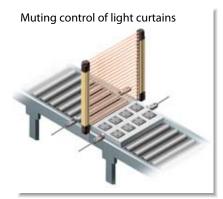




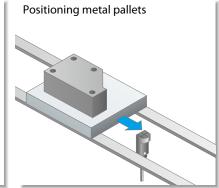

ENVIRONMENTAL RESISTANCE

10 times the durability! (Compared to previous models)

The new integrated construction method used provides shock resistance of 10,000 m/s² (approx. 1,000 G in X, Y and Z directions for three times each), and vibration resistance clears durability tests of between 10 and 500 Hz (3mm 0.118 in amplitude in X, Y and Z directions for 2 hours each). In addition, resistance to impulse noize is approx. three times greater than for previous models.

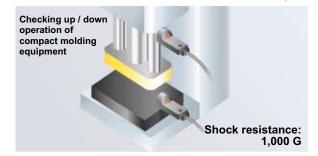


Highly resistant to water or oil! IP68g* protective construction

The new integrated construction method used improves environmental resistance performance.

The IP68g prevents damage to the sensor by stopping water and oil getting inside.

* For details, refer to the "Specifications" (p.652~)



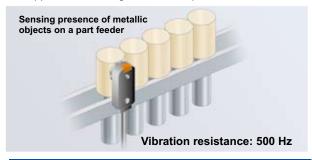

FUNCTIONS

Indicators are easy to see over a wide field of view

A prism with a wide field of view has been developed. This has greatly improved the visibility of the operation indicators.





Tightening strength increased with no damage!


A metal sleeve has been inserted. It is possible to tighten up to 0.7 N·m *.

* Maximum tightening torque for M3 screw.



Conductor thickness doubled to make wiring much easier! (GX- 8 only)

The conductor's thickness was doubled for the GX- 8. This makes it easier to handle and perform crimping work on the cables. In addition, the tensile strength of the crimping area has become higher.

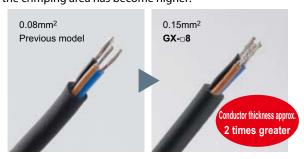

FIBER SENSORS

LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

> AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

NDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide

Amplifier

GX-F/H

GXL

GL

GX-U / GX-FU / GX-N

GX Amplifier-

separated

GA-311 / GH

Other Products



FIBER SENSORS ORDER GUIDE

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS AREA SENSORS

SAFETY COMPONENTS PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide

GXL
GL
GX-IJ/GX-FIJ/GX-N
GX
Amplifier-separated
GA-311/GH
Other
Products

GX-8 type

Ту	/pe	Appearance (mm in)	Sensing range (Note 1)	Model No. (Note 2)	Output	Output operation
	Front sensing	7.4 0.291		GX-F8A		Normally open
				GX-F8AI		
				GX-F8B		
NPN output	늍	0.000	Maximum operation distance 2.5 mm 0.098 in	GX-F8BI	NPN open-collector	Normally closed
PNo		. 🔿		GX-H8A	transistor	Normally open
Z	Top sensing	9.1 0.358 8 0.315 25 0.984		GX-H8AI		
				GX-H8B		Normally closed
				GX-H8BI		
	Front sensing	7.4 0.291 8 0.315 23 0.906	(0 to 2.1 mm 0 to 0.083 in) Stable sensing range	GX-F8A-P		Normally open
				GX-F8AI-P		
_				GX-F8B-P		Normally closed
PNP output				GX-F8BI-P	PNP open-collector	
NP o		9.1 0.358		GX-H8A-P	Averagieta v	Normally open
_	sensing			GX-H8AI-P		
	Top se			GX-H8B-P		Newselledend
	12	8 0.315 0.984		GX-H8BI-P		Normally closed

Notes: 1) The maximum operation distance stands for the maximum distance for which the sensor can detect the standard sensing object.

The stable sensing range stands for the sensing range for which the sensor can stably detect the standard sensing object even if there is an ambient temperature drift and/or supply voltage fluctuation.

2) "I" in the model No. indicates a different frequency type.

GX-12 type

Ту	/pe	Appearance (mm in)	Sensing range (Note 1)	Model No. (Note 2)	Output	Output operation
	Front sensing	7.1 0.280		GX-F12A	NPN open-collector transistor	Normally open
				GX-F12AI		
	ont s	27.8		GX-F12B		
NPN output	포	0.472	Maximum operation distance 4.0 mm 0.157 in (0 to 3.3 mm 0 to 0.130 in) Stable sensing range	GX-F12BI		Normally closed
PNo	Top sensing	1		GX-H12A		Normally open
Z		13 0.512 12 0.472 27.4 1.079		GX-H12AI		
				GX-H12B		Normally closed
				GX-H12BI		
	Front sensing	7.1 0.280 12 27.8 1.094		GX-F12A-P		Normally open
				GX-F12AI-P		
				GX-F12B-P		
PNP output				GX-F12BI-P		Normally closed
NP o		13 0.512		GX-H12A-P	transistor	Normally open
Δ.	sensing			GX-H12AI-P		
	Top se	12 0.472 1.079		GX-H12B-P		
	10 L	12 0.472		GX-H12BI-P		Normally closed

Notes: 1) The maximum operation distance stands for the maximum distance for which the sensor can detect the standard sensing object.

The stable sensing range stands for the sensing range for which the sensor can stably detect the standard sensing object even if there is an ambient temperature drift and/or supply voltage fluctuation.

2) "I" in the model No. indicates a different frequency type.




OPTIONS

Designation	Model No.	Description
Sensor mounting bracket	MS-GXL8-4	Mounting bracket for GX-8 type

Sensor mounting bracket

• MS-GXL8-4



1 pc. each of M3 (length: 12 mm 0.472 in) truss head screw, nut, spring washer and plain washer is attached.

SPECIFICATIONS

GX-8 type

	.,,,,,							
Туре			NPN o	output	PNP c	output		
	Model No.	Front sensing	GX-F8A(I)	GX-F8B(I)	GX-F8A(I)-P	GX-F8B(I)-P		
ltem	Mod	Top sensing	GX-H8A(I)	GX-H8B(I)	GX-H8A(I)-P	GX-H8B(I)-P		
Max. op	peration	distance (Note 3)	2.5 mm 0.098 in ± 8 %					
Stable	sensing	range (Note 3)	0 to 2.1 mm 0 to 0.083 in					
Standard sensing object		ing object	Iron sheet 15 × 15 × t 1 mm 0.591 × 0.591 × t 0.039 in					
Hystere	esis		20 % or less of operation distance (with standard sensing object)					
Repeat	tability		Ald	ong sensing axis, perpendicular to	sensing axis: 0.04 mm 0.002 in or le	ess		
Supply	/ voltage	e		12 to 24 V DC ⁺¹⁰ %	Ripple P-P 10 % or less			
Curren	nt consu	mption		15 mA	A or less			
Output			Residual voltage: 1 V or less	ess (between output and 0 V)	 Residual voltage: 1 V or less 	less(between output and +V)		
L	Jtilizatio	on category	DC-12 or DC-13					
Output operation		operation	Normally open	Normally closed	Normally open	Normally closed		
Max. re	esponse	frequency	500 Hz					
Operat	tion ind	icator	Orange LED (lights up when the output is ON)					
Р	Pollution degree		3 (Industrial environment)					
	Protection		IP68 (IEC), IP68g (JEM) (Refer to p.1010 for details of standards.) (Note 4, 5)					
Environmental resistance	Ambient	t temperature	-25 to +70 °C −13 to +158 °F, Storage: -40 to +85 °C −40 to +185 °F					
resis	Ambient	t humidity		45 to 85 % RH, Storage: 35 to 95 % RH				
ental	EMC		EN 60947-5-2					
uu v	/oltage	withstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure					
Envir	nsulatio	on resistance	50 MΩ, or more, v	th 500 V DC megger between all supply terminals connected together and enclosure				
V	/ibratio	n resistance	10 to 500 Hz frequency, 3 mm 0.118 in amplitude in X, Y and Z directions for two hours each					
S	Shock re	esistance	10,000 m/s ² acceleration (1,000 G approx.) in X, Y and Z directions for three times each					
Sensing range	g Te	emperature characteristics	Over ambient tempe	erature range –25 to +70 °C –13 to	to +158 °F: Within ± 8 % of sensing range at +23 °C +73 °F			
variatio	on Vo	oltage characteristics		Within $\pm 2\%$ for $^{+10}_{-15}\%$ fluct	ctuation of the supply voltage			
Materia	al			Enclosure: PBT, Indi	icator part: Polyester			
Cable			0.1	5 mm ² 3-core oil, heat and cold re	sistant cabtyre cable, 1 m 3.281 ft lo	ong		
Cable e	extensio	on	Extension up to total 100 m 328.084 ft is possible with 0.3 mm², or more, cable.					
			4					

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.

2) "I" in the model No. indicates a different frequency type.

3) The maximum operation distance stands for the maximum distance for which the sensor can detect the standard sensing object.

The stable sensing range stands for the sensing range for which the sensor can stably detect the standard sensing object even if there is an ambient temperature drift and/or supply voltage fluctuation.

4) SUNX's IP68 test method

Net weight

① Immerse at 0 m below 0 °C +32 °F water surface and leave for 30 min. Then, immerse at 0 m below +70 °C +158 °F water surface and leave for 30 min.

Front sensing type: 15 g approx., Top sensing type: 20 g approx..

- ② Regard the heat shock test in ③ one cycle and perform 20 cycles.
- 3 Leave in water at a depth of 1 m 3.281 ft in water for 500 hours.
- ④ After tests ① to ③ Insulation resistance, voltage with standability, current consumption, and sensing ranges must meet the standard values.
- 5) If using the sensor in an environment where cutting oil droplets splatter, the sensor may deteriorate due to added substances in the oil.

FIBER SENSORS LASER

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR

SENSORS
SENSOR

SENSOR OPTIONS

WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide Amplifier

GXL

GL GX-U/GX-FU/ GX-N

GX

Amplifierseparated

GA-311 / GH

SUNX

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

PARTICULAR USE SENSORS SENSOR OPTIONS

SAVING SYSTEMS MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

GXL GL GX-U / GX-FU / GX-N GX

Amplifier-separated GA-311 / GH Other Products

SPECIFICATIONS

GX-12 type

GX-1	2 type						
	Туре		NPN c	utput	PNP output		
	\ 2	Front sensing	GX-F12A(I)	GX-F12B(I)	GX-F12A(I)-P	GX-F12B(I)-P	
Item		Front sensing Top sensing	GX-H12A(I)	GX-H12B(I)	GX-H12A(I)-P	GX-H12B(I)-P	
Max.	peratio	n distance (Note 3)	4.0 mm 0.158 in ± 8 %				
Stable sensing range (Note 3)			0 to 3.3 mm 0 to 0.130 in				
Standard sensing object			Iron sheet 20 × 20 × t 1 mm 0.787 × 0.787 × t 0.039 in				
Hysteresis			20 % or less of operation distance (with standard sensing object)				
Repe	atability	,	Ald	ong sensing axis, perpendicular to	sensing axis: 0.04 mm 0.002 in or le	255	
Supp	ly volta	ge		12 to 24 V DC ⁺¹⁰ %	Ripple P-P 10 % or less		
Curre	nt cons	umption		15 mA	or less		
Output			• Residual voltage: 1 V or less	ess (between output and 0 V)	PNP open-collector transistor Maximum source current: 100 mA Applied voltage: 30 V DC or less(between output and +V) Residual voltage: 1 V or less (at 100 mA source current) 0.4 V or less (at 16 mA source current)		
	Utiliza	ion category	DC-12 or DC-13				
	Outpu	operation	Normally open	Normally closed	Normally open	Normally closed	
Max. response frequency		se frequency	500 Hz				
Opera	ation in	dicator	Orange LED (lights up when the output is ON)				
	Pollution degree		3 (Industrial environment)				
a,	Protection		IP68 (IEC), IP68g (JEM) (Refer to p.1010 for details of standards.) (Note 4, 5)				
Environmental resistance	Ambie	nt temperature	−25 to +70 °C −13 to +158 °F, Storage: −40 to +85 °C −40 to +185 °F				
resis	Ambie	nt humidity	45 to 85 % RH, Storage: 35 to 95 % RH				
ental	EMC		EN 60947-5-2				
onm.	Voltag	withstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure				
Envir	Insulat	ion resistance	$50M\Omega$, or more, with $500V$ DC megger between all supply terminals connected together and enclosure				
	Vibrati	on resistance	10 to 500 Hz frequency, 3 mm 0.118 in amplitude in X, Y and Z directions for two hours each				
	Shock	resistance	10,000 m/s ² acceleration (1,000 G approx.) in X, Y and Z directions for three times each				
Sensi	_	Temperature characteristics	Over ambient temperature range –25 to +70 °C –13 to +158 °F: Within ± 8 % of sensing range at +23 °C +73 °F				
variat		Voltage characteristics		Within $\pm 2\%$ for $^{+10}_{-15}\%$ fluctuation of the supply voltage			
Mate	rial			Enclosure: PBT, Indi	cator part: Polyester		
Cable			0.1	5 mm ² 3-core oil, heat and cold res	sistant cabtyre cable, 1 m 3.281 ft lo	ong	
Cable	extens	ion	Exter	nsion up to total 100 m 328.084 ft i	s possible with 0.3 mm ² , or more, c	able.	
Net w	eight			Front sensing type: 20 g approx.	., Top sensing type: 20 g approx		


- Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.
 - 2) "I" in the model No. indicates a different frequency type.
 - 3) The maximum operation distance stands for the maximum distance for which the sensor can detect the standard sensing object. The stable sensing range stands for the sensing range for which the sensor can stably detect the standard sensing object even if there is an ambient temperature drift and/or supply voltage fluctuation.
 - 4) SUNX's IP68 test method
 - (a) Indiresse at 0 m below 0 °C +32 °F water surface and leave for 30 min. Then, immerse at 0 m below +70 °C +158 °F water surface and leave for 30 min.

 (a) Regard the heat shock test in (b) one cycle and perform 20 cycles.

 - 3 Leave in water at a depth of 1 m 3.281 ft in water for 500 hours.
 4 After tests no (3) insulation resistance, voltage withstandability, current consumption, and sensing ranges must meet the standard values.
 - 5) If using the sensor in an environment where cutting oil droplets splatter, the sensor may deteriorate due to added substances in the oil.

I/O CIRCUIT DIAGRAMS


GX-⊠

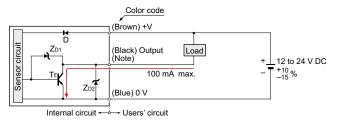

Note: The output does not incorporate a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load.

: Reverse supply polarity protection diode ZD1, ZD2: Surge absorption zener diode Tr : NPN output transistor

GX-⊠-P

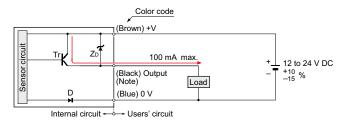

Note: The output does not incorporate a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load.


Symbols ... D : Reverse supply polarity protection diode ZD: Surge absorption zener diode Tr: PNP output transistor


SENSING CHARACTERISTICS (TYPICAL)

GX-8 type

Sensing field

Correlation between sensing object size and sensing range

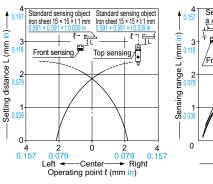


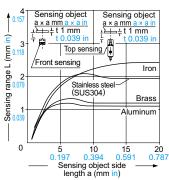



As the sensing object size becomes smaller than the standard size (iron sheet $15 \times 15 \times t$ 1 mm $0.591 \times 0.591 \times t$ 0.039 in), the sensing range shortens as shown in the left figures.

GX-12 type

Sensing field

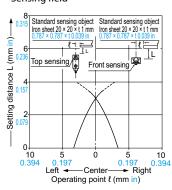



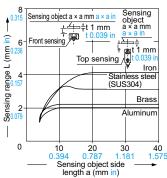

As the sensing object size becomes smaller than the standard size (iron sheet $20 \times 20 \times t$ 1 mm $0.787 \times 0.787 \times t$ 0.039 in), the sensing range shortens as shown in the left figure.

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

CONTROL DEVICES LASER MARKERS

Selection Guide

GXL GL

GX-U / GX-FU GX

Amplifier-separated

GA-311 / GH Other Products ELECTRIC SENSORS

Other

Products

PRECAUTIONS FOR PROPER USE

Refer to p.1012~ for general precautions.


 Never use this product as a sensing device for personnel protection.

 In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.

Mounting


GX-8 type

 Make sure to use a M3 (length: 12 mm 0.472 in or more) truss head screw. The tightening torque should be 0.7 N·m or less. Do not use a flat head screw or a pan head \screw.

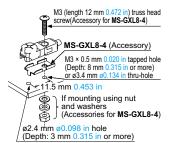

GX-12 type


- The tightening torque should be 0.7 N·m or less.
- To mount the sensor with a nut, the mouting hole diameter should be ø3.4 mm Ø0.134 in. Further, the hole in which the boss is inserted should be ø2.5 mm Ø0.098 in and 3 mm 0.118 in, or more, deep.

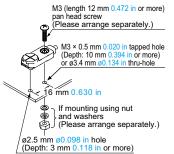

Influence of surrounding metal

 When there is a metal near the sensor, keep the minimum separation distance specified below.


Front sensing type



	GX-F8	GX-F12
Α	7.4 mm 0.291 in	7.1 mm 0.280 in
В	8 mm 0.315 in	20 mm 0.787 in
C	3 mm 0.118 in	7 mm 0.276 in

CV FO

Top sensing type




	GX-H8	GX-H12	
D	4 mm 0.157 in	7 mm 0.276 in	
Е	10 mm 0.394 in	20 mm 0.787 in	
F	3 mm 0.118 in	3 mm 0.118 in	
G	3 mm 0.118 in	3 mm 0.118 in	

Mutual interference prevention

 When two or more sensors are installed in parallel or face to face, keep the minimum separation distance specified below to avoid mutual interference.

	Н	J	
GX-F8	Between "I" type	0 mm	15 mm
	and non "I" type	(Note 2)	0.591 in
GX-F8	Between two "I" types	20 mm	35 mm
	or two non "I" types	0.787 in	1.378 in
CVIII	Between "I" type	0 mm	15 mm
	and non "I" type	(Note 2)	0.591 in
GX-H8	Between two "I" types	20 mm	35 mm
	or two non "I" types	0.787 in	1.378 in
GX-F12	Between "I" type	0 mm	25 mm
	and non "I" type	(Note 2)	0.984 in
GX-H12	Between two "I" types	25 mm	50 mm
	or two non "I" types	0.984 in	1.969 in

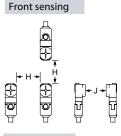

Notes: 1) "I" in the model No. specifies the different frequency type.

2) Close mounting is possible for up to two sensors. When mounting three sensors or more at an equal spacing, align the model with "I" and the model without "I" alternately. The minimum value of dimension "H" should be as given below.

GX-8 type: 6mm 0.236 in GX-12 type: 6.5mm 0.256 in

Top sensing

O O o

Sensing range

 The sensing range is specified for the standard sensing object. With a non-ferrous metal, the sensing range is obtained by multiplying with the correction coefficient specified below. Further, the sensing range also changes if the sensing object is smaller than the standard sensing object or if the sensing object is plated.

Correction coefficient

Model No. Metal	GX-8 type	GX-12 type
Iron	1	1
Stainless steel (SUS304)	0.76 approx.	0.79 approx.
Brass	0.50 approx.	0.56 approx.
Aluminum	0.48 approx.	0.53 approx.

Others

- The output does not incorporate a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load.
- Do not use during the initial transient time (50 ms) after the power supply is switched on.

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

PARTICULAR USE SENSORS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

CONTROL DEVICES

LASER MARKERS

DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.com

GX-F8 GX-H8 Operation indicator (Orange) Operation indicator (Orange) Sensing 3- 5.4 0.213 6.3 0.248 2.95 ø3 ø0.118 cable, 1 m 3.281 ft long Sensing 8.55 6.8 direction 11.5 0.453 7.7 23 0.906 R4.25 3.85 22.5 .45. <u>▼</u> 6.5 ø3.1 ø0.12 9.75 0 mounting hole 3-4.8 0.189 5.3 0.209 2.5 0.098 2.65 0.039

GX-H12

GX-F12

Operation indicator (Orange) - 3.3 0.130 -1.5 0.059 Sensing ø2.3 direction 27.8 27 1.005 1.063 11.05 0.435 16 0.630 16 ø3.1 ø0.12 mounting hole 12.4 ø6 ø0.236 screw seat, 0.8 0.032 deep 4.4 0.173 ŧ 6.8 0.26° ø3 ø0.118 cable, 1 m 3.281 ft long 2.8 110 0.

Operation indicator (Orange) Sensing direction ø3.1 ø0.122 mounting hole 22.2 ø6 ø0.236 screw seat, 1.4 0.055 deep 8.65 0.341 -- 5.5 |-R6.25 R0.246 12 12.5 6.5 0.256 3.1 5.8 0.12 0.228 -16 2.5 0.098 27.4 1.079

Mounting hole dimensions

Center of

M

ø2.4 ø0.094 hole, 3 0.118 or more deep


8 0.315 or more deep

M3 × 0.5 0.020

tapped hole,

MS-GXL8-4

Sensor mounting bracket for GX-8 type (optional)

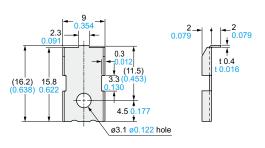

Material: Stainless steel (SUS304)

1 pc. each of M3 (length 12 mm 0.472 in) truss head screw, nut, spring washer and plain washer are attached.

Selection Guide

GXL GL

GX-U / GX-FU / GX-N GX

Amplifier-separated

GA-311 / GH Other Products