3.2x1.6mm SMD CHIP LED LAMP

Part Number: KP-3216SYCK Super Bright Yellow


Features

- 3.2mmx1.6mm SMT LED, 1.1mm thickness.
- Low power consumption.
- Wide viewing angle.
- Ideal for backlight and indicator.
- Various colors and lens types available.
- Package : 2000pcs / reel.
- Moisture sensitivity level : level 3.
- RoHS compliant.

Description

The Super Bright Yellow device is made with AlGaInP (on GaAs substrate) light emitting diode chip.

Package Dimensions

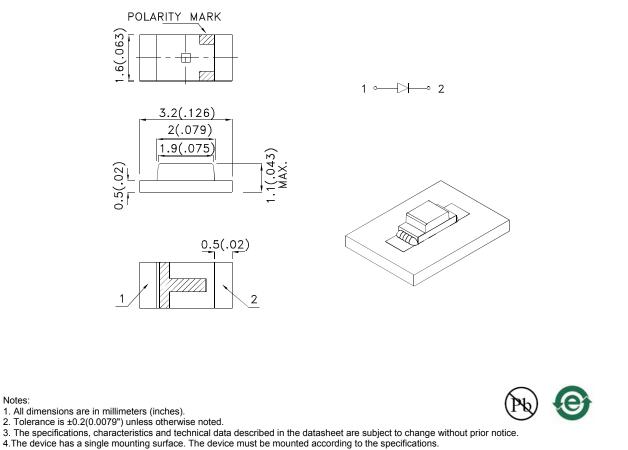

Notes:

REV NO: V.13B **CHECKED: Allen Liu** DATE: FEB/03/2012 **DRAWN: C.H.Han**

PAGE: 1 OF 5 ERP: 1203000429

Selection Guide

Part No.	Dice	Lens Type	lv (mcd) [2] @ 20mA		Viewing Angle [1]
			Min.	Тур.	201/2
KP-3216SYCK	Super Bright Yellow (AlGaInP)	Water Clear	80	150	120°

Notes:

1. 01/2 is the angle from optical centerline where the luminous intensity is 1/2 of the optical peak value.
Luminous intensity/ luminous Flux: +/-15%.

3. Luminous Intensity value is traceable to the CIE127-2007 compliant national standards.

Electrical / Optical Characteristics at TA=25°C

Symbol	Parameter	Device	Тур.	Max.	Units	Test Conditions
λpeak	Peak Wavelength	Super Bright Yellow	590		nm	I⊧=20mA
λD [1]	Dominant Wavelength	Super Bright Yellow	590		nm	I⊧=20mA
Δλ1/2	Spectral Line Half-width	Super Bright Yellow	20		nm	IF=20mA
С	Capacitance	Super Bright Yellow	20		pF	VF=0V;f=1MHz
VF [2]	Forward Voltage	Super Bright Yellow	2	2.5	V	I⊧=20mA
IR	Reverse Current	Super Bright Yellow		10	uA	VR=5V

Notes:


1.Wavelength: +/-1nm. 2. Forward Voltage: +/-0.1V.

3.Wavelength value is traceable to the CIE127-2007 compliant national standards.

Absolute Maximum Ratings at TA=25°C


Parameter	Super Bright Yellow	Units		
Power dissipation	75	mW		
DC Forward Current	30	mA		
Peak Forward Current [1]	175	mA		
Reverse Voltage	5	V		
Operating Temperature	-40°C To +85°C			
Storage Temperature	-40°C To +85°C			

Note: 1. 1/10 Duty Cycle, 0.1ms Pulse Width.

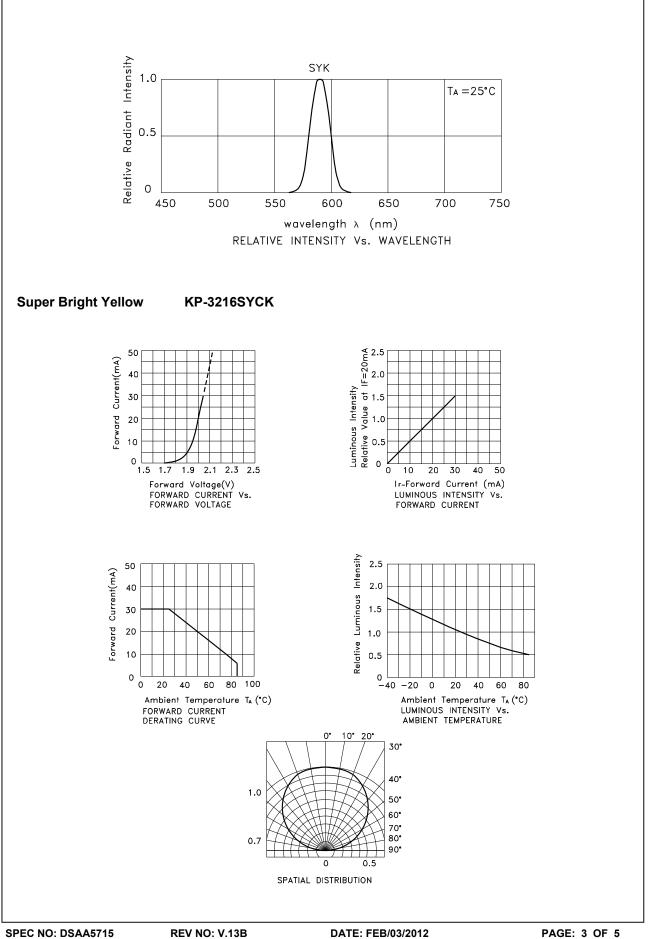

KP-3216SYCK

Reflow soldering is recommended and the soldering profile is shown below. Other soldering methods are not recommended as they might cause damage to the product.

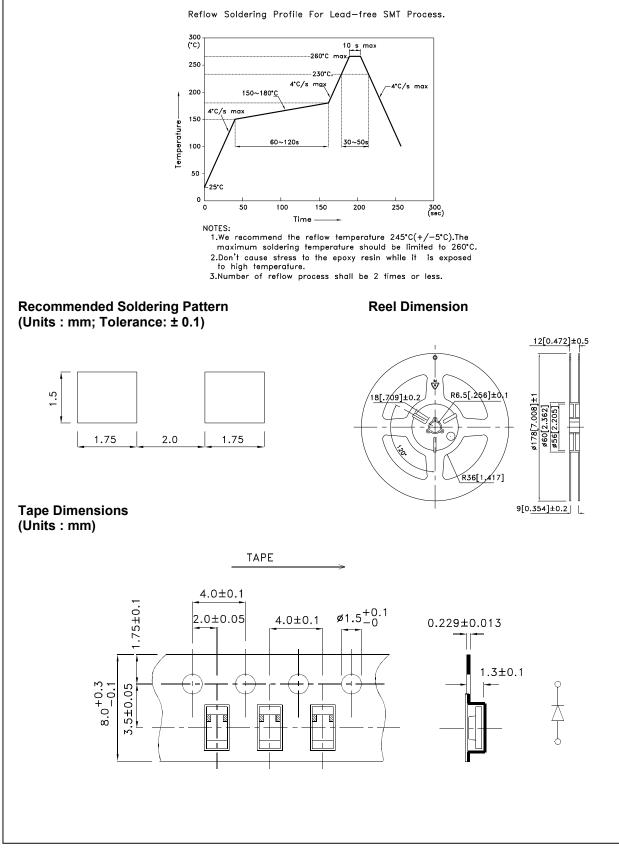

DATE: FEB/03/2012 DRAWN: C.H.Han PAGE: 4 OF 5 ERP: 1203000429

