

NOTE



All numerical values are in metric units [with U.S. customary units in brackets]. Dimensions are in millimeters [and inches]. Unless otherwise specified, dimensions have a tolerance of ± 0.13 [$\pm .005$] and angles have a tolerance of $\pm 2^\circ$. Figures and illustrations are for identification only and are not drawn to scale.

1. INTRODUCTION

This specification covers the requirements for the application of Type III+ (Size 16) Contacts. These contacts have a pin diameter of 1.57 mm [.062 in.]. A color dot appears on the loose piece or (loose piece only) contact spring which designates the applicable wire size and matches the color dot above the hand tool crimping section. These requirements apply to hand or automatic machine crimping tools for the insulated grip contacts.

When corresponding with TE Connectivity (TE) Personnel, use the terminology provided on this specification to help facilitate your inquiry for information. Basic terms and features of components are provided in Figure 1.

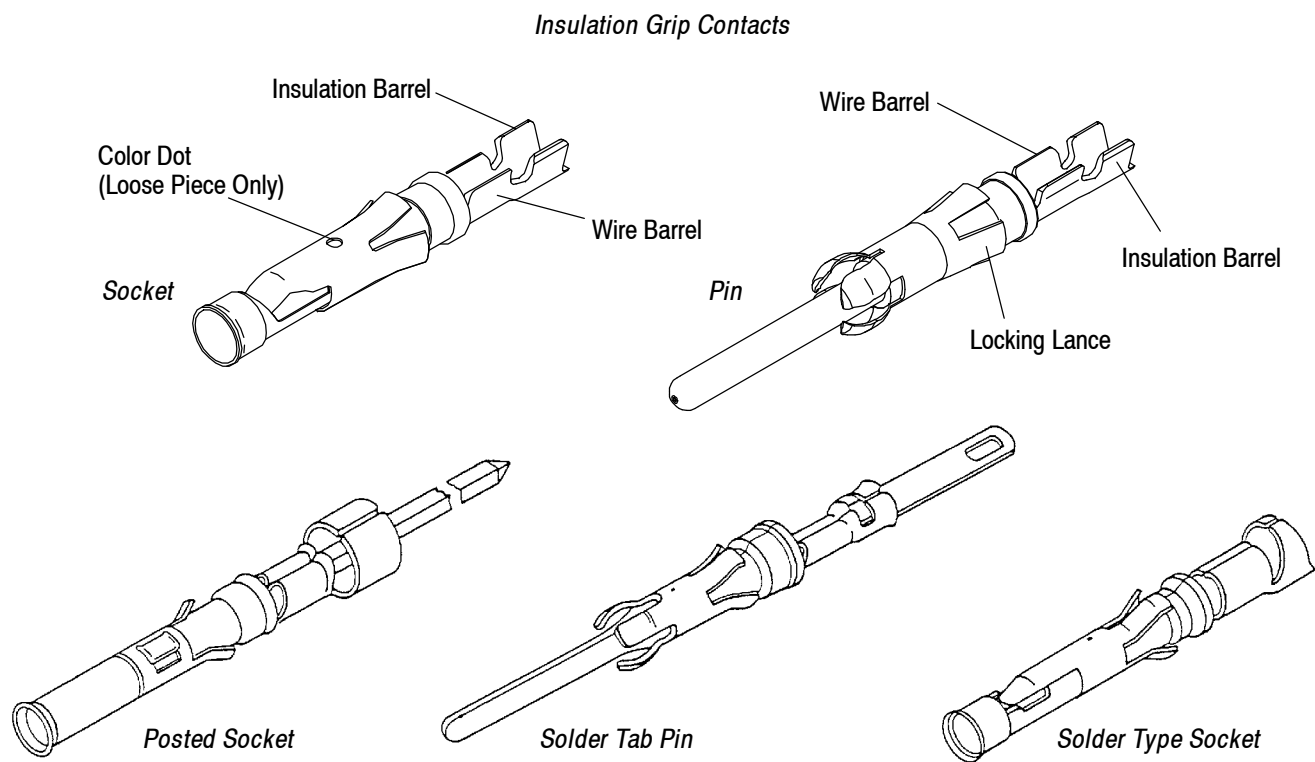


Figure 1

2. REFERENCE MATERIAL

2.1. Revision Summary

- Updated document to corporate requirements
- New logo

2.2. Customer Assistance

Reference Base Part Number 66098 and Product Code 5022 are representative numbers of the Type III+ (Size 16) Contacts. Use of these numbers will identify the product line and expedite your inquiries through a service network established to help you obtain product and tooling information. Such information can be obtained through a TE Representative or, after purchase, by calling the Product Information Center at the number at the bottom of this page.

2.3. Drawings

Customer Drawings for product part numbers are available from the service network. The information contained in the Customer Drawings takes priority if there is a conflict with this specification or with any other technical documentation supplied by TE.

2.4. Manuals

Manual 402-40 is available upon request and can be used as a guide in soldering. This manual provides information on various flux types and characteristics along with the commercial designation and flux removal procedures. A checklist is included in the manual as a guide for information on soldering problems.

2.5. Specifications

Product Specification 108-10042 provides product performance requirements and test information.

2.6. Instructional Material

The following list includes available instruction sheets (408-series) that provide assembly procedures for product, operation, maintenance and repair of tooling, as well as setup and operation procedures of applicators; and customer manuals (409-series) that provide setup, operation, and maintenance of machines.

<u>Document Number</u>	<u>Document Title</u>
408-1216	Extraction Tools 305183-[]
408-1379	Selection Charts for Multimate Pin and Socket Contacts
408-3295	Preparing Reel of Contacts for Application Tooling
408-7347	Insertion Tools 91002-[]
408-7414	Hand Crimping Tool 90225-2
408-7424	Checking Terminal Crimp Height or Gaging Die Closure
408-7773	Hand Crimping Tool 90331-1
408-8039	Heavy Duty Miniature Quick-Change Applicators (End-Feed Type)
408-8040	Heavy Duty Miniature Quick-Change Applicators (Side-Feed Type)
408-8059	General Preventive Maintenance for Applicators
408-8547	CERTI-CRIMP* II Straight action Hand Tools
408-9640	Crimp Quality Monitor Applicators for Side-Feed and End-Feed Applications
408-9816	Handling of Reeled Products
409-5128	Basic AMP-O-LECTRIC* Model "K" Terminating Machine 565435-5
409-5842	AMP-O-LECTRIC Model "G" Terminating Machines 354500-[]
409-5852	AMPOMATOR* CLS III-G Lead-Making Machine 122500-[]
409-5866	AMPOMATOR CLS IV Lead-Making Machine 217500-[]
409-5870	Crimp Quality Monitors (CQM) for AMPOMATOR CLS IV Lead-Making Machines
409-5878	AMPOMATOR CLS IV+ Lead-Making Machine 356500-[]
409-10012	AMP-O-MATIC* Side Feed Stripper-Crimper III Machine 1320895-[]
409-10016	Entry Level Terminator (ELT) Machine 1338600-[]
409-10027	Stripping Modules 1490500 and 1490502
409-10029	Stripping Modules 1490501 and 1490503

3. REQUIREMENTS

3.1. Storage

A. Ultraviolet Light

Prolonged exposure to ultraviolet light may deteriorate the chemical composition used in the contacts.

B. Reel Storage

When using reeled contacts, store coil wound reels horizontally and traverse wound reels vertically.

C. Shelf Life

The contacts should remain in the shipping containers until ready for use to prevent deformation to the contact. The contacts should be used on a first in, first out basis to avoid storage contamination that could adversely affect signal transmissions.

D. Chemical Exposure

Do not store contacts near any chemicals listed below as they may cause stress corrosion cracking in the contacts.

Alkalies	Ammonia	Citrates	Phosphates	Citrates	Sulfur Compounds
Amines	Carbonates	Nitrites	Sulfur Nitrites	Tartrates	

NOTE



Where the above environmental conditions exist, phosphor-bronze contacts are recommended instead of brass if available.

3.2. Special Characteristics

The solder type and solder tab versions will accept various sizes of solid or stranded wire. For soldering requirements, follow the recommendations of the wire manufacturer and soldering equipment manufacturer. Refer to Manual 402-40.

3.3. Wire Selection and Preparation

The total wire size range for these contacts is 30 through 14 AWG. The wire must be stripped to the dimensions shown in Figure 2.

NOTE




The applied crimp dimension (within the functional range of the product) is dependent on the termination tooling being used. Refer to the documentation (applicator logs and instruction sheets) supplied with the termination tooling for the applied crimp height. See Section 5, TOOLING.

CAUTION



DO NOT nick, scrape, or cut the wire conductor during the stripping operation.

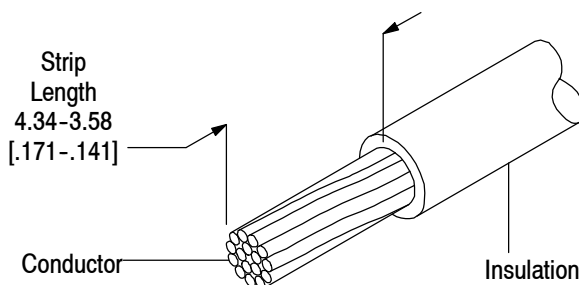

WIRE SIZE, AWG	INSULATION DIAMETER	WIRE BARREL CRIMP		INSULATION BARREL CRIMP WIDTH
		HEIGHT	WIDTH	
30-26	0.36-0.76 [.014-.030]	1.05-0.89 [.0415-.035]	1.75-1.57 [.069-.062]	1.60-1.20 [.063-.047]
	1.02-1.52 [.040-.060]	1.05-0.89 [.0415-.035]	1.75-1.57 [.069-.062]	1.98-1.58 [.078-.062]
26	0.89-1.40 [.035-.055]	0.84-0.74 [.033-.029]	1.57-1.40 [.062-.055]	1.98-1.58 [.078-.062]
24	2.03-2.54 [.080-.100]	1.04-0.86 [.041-.034]	1.75-1.57 [.069-.062]	3.25-2.85 [.128-.112]
	1.52-3.43 [.060-.135]	0.97-0.76 [.038-.030]	1.75-1.57 [.069-.062]	3.25-2.84 [.128-.112]
	1.02-2.03 [.040-.080]	1.05-0.86 [.0415-.034]	1.75-1.57 [.069-.062]	2.49-2.09 [.098-.082]
	0.89-1.40 [.035-.055]	0.89-0.74 [.035-.029]	1.57-1.40 [.062-.055]	1.98-1.58 [.078-.062]
(2) 24	1.52-3.43 [.060-.135]	1.07-0.86 [.042-.034]	1.75-1.57 [.069-.062]	3.25-2.84 [.128-.112]
	1.02-2.03 [.040-.080]	1.07-0.97 [.042-.038]	1.75-1.57 [.069-.062]	2.49-2.09 [.098-.082]
22	2.03-2.54 [.080-.100]	1.04-0.91 [.041-.036]	1.75-1.57 [.069-.062]	3.25-2.85 [.128-.112]
	1.52-3.43 [.060-.135]	1.02-0.81 [.040-.032]	1.75-1.57 [.069-.062]	3.25-2.84 [.128-.112]
	1.02-2.03 [.040-.080]	1.05-0.91 [.0415-.036]	1.75-1.57 [.069-.062]	2.49-2.09 [.098-.082]

Figure 2 (cont'd)

WIRE SIZE, AWG	INSULATION DIAMETER	WIRE BARREL CRIMP		INSULATION BARREL CRIMP WIDTH
		HEIGHT	WIDTH	
20	2.03-2.54 [.080-.100]	1.12-0.94 [.044-.037]	1.75-1.57 [.069-.062]	3.25-2.85 [.128-.112]
	1.52-3.43 [.060-.135]	1.12-0.91 [.044-.036]	1.75-1.57 [.069-.062]	3.25-2.84 [.128-.112]
	1.02-2.03 [.040-.080]	1.12-0.95 [.044-.0375]	1.75-1.57 [.069-.062]	2.49-2.09 [.098-.082]
18	2.79-3.81 [.110-.150]	1.37-1.24 [.054-.049]	2.46-2.29 [.097-.090]	4.16-3.76 [.163-.147]
	2.03-2.54 [.080-.100]	1.35-1.24 [.053-.049]	2.20-2.03 [.087-.080]	3.25-2.85 [.128-.112]
16	2.79-3.81 [.110-.150]	1.55-1.24 [.061-.049]	2.46-2.29 [.097-.090]	4.16-3.76 [.163-.147]
	2.03-2.54 [.080-.100]	1.47-1.24 [.058-.049]	2.20-2.03 [.087-.080]	3.25-2.85 [.128-.112]
14	2.79-3.81 [.110-.150]	1.78-1.68 [.070-.066]	2.46-2.29 [.097-.090]	4.16-3.76 [.163-.147]
	2.03-2.54 [.080-.100]	1.78-1.68 [.070-.066]	2.46-2.29 [.097-.090]	3.25-2.85 [.128-.112]

Figure 2 (end)

3.4. Crimped Contact Requirements

The contact must be crimped onto the wire according to instructions packaged with applicable tooling. After crimping, the contact should appear as shown in Figure 3. A typical pin contact is shown as it should appear after crimping; these requirements apply equally to the socket contact.



The wire insulation must not be damaged during the crimping process.

A. Wire Barrel Crimp

The crimp applied to the wire portion of the contact is the most compressed area and is most critical in ensuring optimum electrical and mechanical performance of the crimped contact. The contact wire barrel crimp height must be within the dimension provided in Figure 2.

B. Effective Crimp Length

For optimum crimp effectiveness, the crimp must be within the area shown in Figure 3 and must meet the crimp dimensions provided in Figure 2. Effective crimp length shall be defined as that portion of the wire barrel, excluding bellmouth(s), fully formed by the crimping tool. Instructions for adjusting, repairing, and inspecting tools are packaged with the tools. See Section 5, TOOLING.

C. Bellmouths

Front and rear bellmouths shall be evident and conform to the dimensions given in Figure 3.

D. Cutoff Tabs

The cutoff tab shall be cut to the dimensions shown in Figure 3.

E. Burrs

The cutoff burr shall not exceed the dimensions shown in Figure 3.

F. Wire Barrel Flash

The wire barrel flash shall not exceed the dimensions shown in Figure 3, Section X-X.

G. Insulation Barrel Crimp

The insulation barrel shall grip the insulation firmly. A slight cut in the insulation by the insulation barrel is permissible as this causes no problems in actual use. Insulation crimp shall comply to width and height provided in Figure 3.

H. Wire Location

The wire conductor and insulation must be visible in the transition area between the wire and insulation barrels.

I. Conductor Extension

The conductor may extend beyond the wire barrel to the maximum shown.

J. Wire Barrel Seam

The wire barrel seam must be closed with no evidence of loose wire strands visible in the seam.

NOTE



Periodic inspections must be made to ensure crimped contact formation is consistent as referenced.

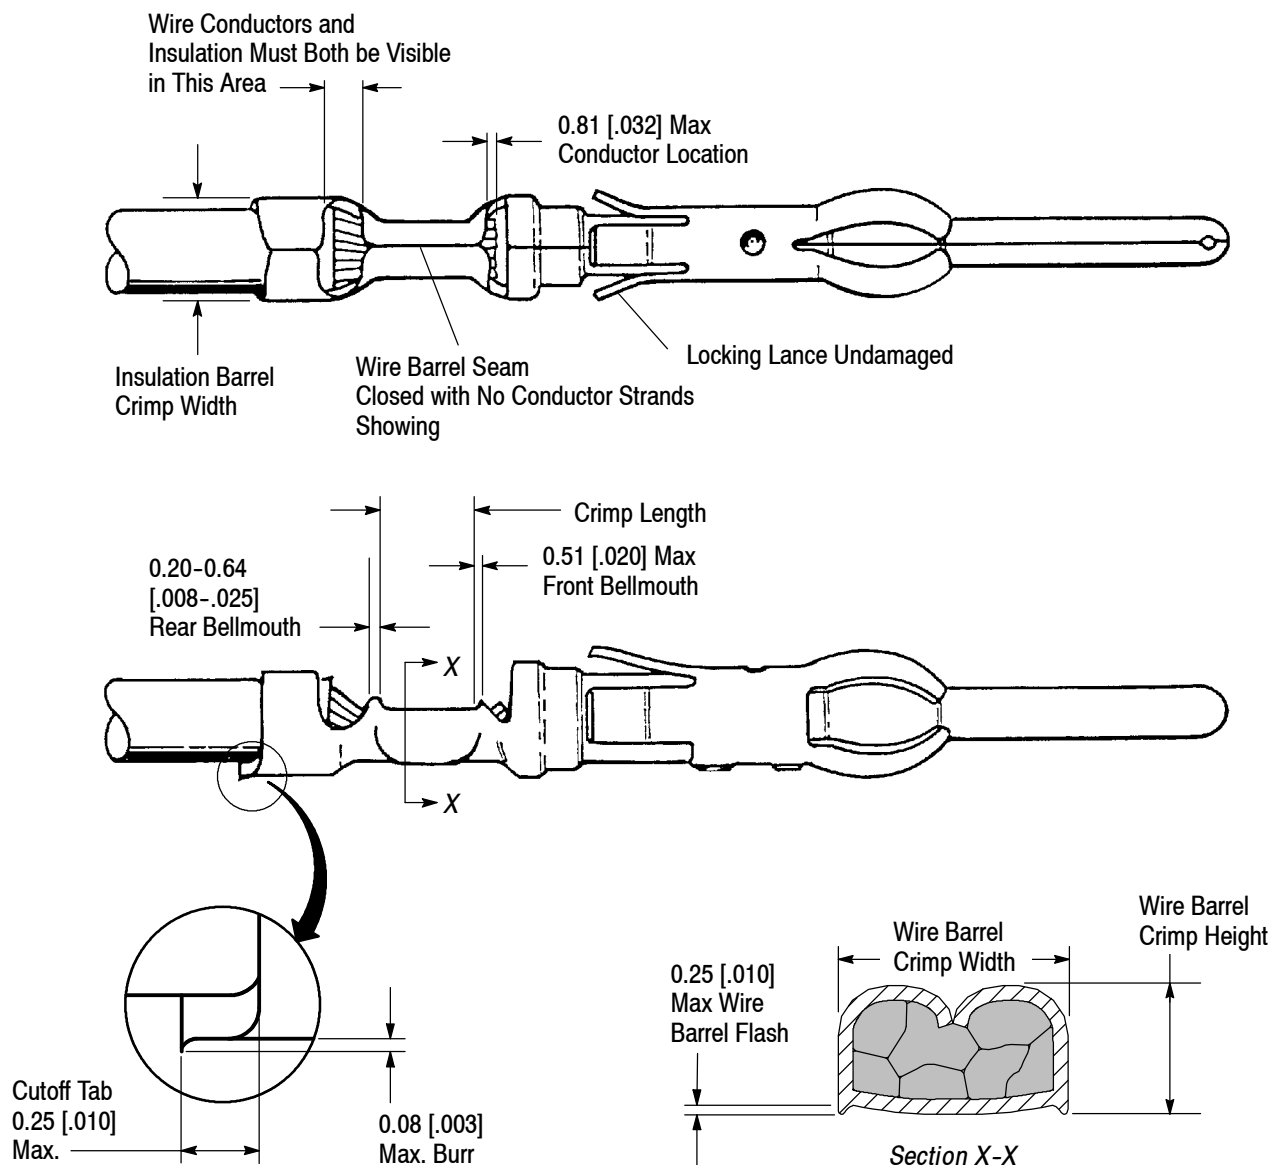


Figure 3

3.5. Axial Concentricity

The axial concentricity of a crimped contact must be within an area defined by the diameter of a circle that has the same center as the centerline of the contact. The diameter of the circle will depend on the wire sizes. See Figure 4. This measurement does not apply to posted contacts.

WIRE SIZE, AWG	CIRCLE DIAMETER
30 - 28	3.40 [.134]
26 - 20	3.40 [.134]
18 - 14	4.16 [.164]

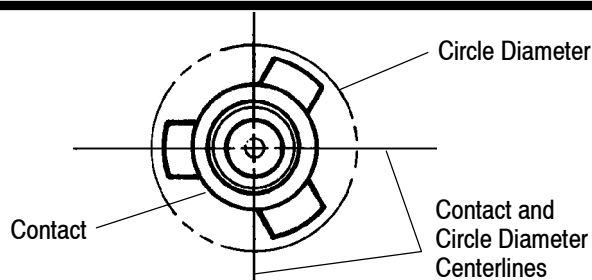


Figure 4

3.6. Posted Sockets

The posted sockets accept TERMI-POINT* Connectors or wrap-type terminations. They can accommodate up to three terminations per post. For terminating requirements, follow the instructions pertaining to specific choice of termination method and tooling types used.

3.7. Solder Tab Pin and Sockets

Observe all guidelines and procedures when solder type contacts are required. Solder, clean, and dry all wire leads to the contacts according to the following:

A. Flux Selection

The wire lead and contact wire barrel interior shall be fluxed prior to soldering using a mildly active rosin. Selection of the proper flux will depend on the type of pc board and other components mounted on the board. Additionally, the flux will have to be compatible with the wave solder line, manufacturing, and safety requirements.

B. Cleaning

After soldering, removal of fluxes, residues, and activators is necessary. Consult with the supplier of the solder and flux for recommended cleaning solvents. The following is a list of common cleaners that will not affect the connectors for the times and temperatures shown. See Figure 5.



Consideration must be given to toxicity and other safety and health requirements as recommended in the Material Safety Data Sheet supplied by the solder cleaner solvent manufacturer.

CLEANER		TIME (Minutes)	TEMPERATURES (Maximum)	
NAME	TYPE		CELSIUS	FAHRENHEIT
ALPHA 2110	Aqueous	1	132	270
BIOACT EC-7	Solvent	5	100	212
Butyl CARBITOL	Solvent	1	Room Ambience	
Isopropyl Alcohol	Solvent	5	100	212
KESTER 5778	Aqueous	5	100	212
KESTER 5779	Aqueous	5	100	212
LONCOTERGE 520	Aqueous	5	100	212
LONCOTERGE 530	Aqueous	5	100	212
Terpene Solvent	Solvent	5	100	212

Figure 5

C. Drying

When drying cleaned assemblies and pc boards, make certain that temperature limitations of -55° to 105°C [-67° to 222°F] are not exceeded. Excessive temperatures may cause housing degradation.

D. Soldering Guideline

Refer to Paragraph 2.4, Manuals, for information on soldering requirements.

ALPHA, BIOACT, CARBITOL, KESTER, and LONCOTERGE are trademarks of their respective owners.

3.8. Repair/Replace

Contacts are not repairable once a termination has been made. Any defective or damaged contact must be removed and replaced with a new one.

Use Extraction Tool 305183 to remove individual contacts from housings for replacement or for relocation to another housing cavity.

4. QUALIFICATION

No qualifications or approvals are required for Type III+ Contacts.

5. TOOLING

These contacts can be terminated to wire using hand, semi-automatic, or automatic crimping tools. Recommended tooling is provided in Figure 6.

NOTE



TE Tooling Engineers have designed machines for a variety of application requirements. For assistance in setting up prototype and production line equipment, contact TE Tool Engineering through your local TE Representative or call the Tooling Assistance Center number at the bottom of page 1.

• Hand Crimping Tool

Hand crimping tools that accommodate the full wire size range are designed for prototype and low-volume applications such as repair of damaged contacts.

• Applicator

Applicators are designed for the full wire size range of strip-fed, precision formed contacts, and provide for high volume, heavy duty, production requirements. The applicators can be used in bench or floor model power units.

NOTE



Each applicator is shipped with a metal identification tag attached. DO NOT remove this tag or disregard the information on it. Also, a packet of associated paperwork is included in each applicator shipment. This information should be read before using the applicator; then it should be stored in a clean, dry area near the applicator for future reference. Some changes may have to be made to the applicators to run in all related power units. Contact the Tooling Assistance Center number located at the bottom of page 1 for specific changes.

• Power Units

A power unit is an automatic or semi-automatic device used to assist in the application of a product. Power unit includes the power source used to supply the force or power to an applicator.

• Insertion/Extraction Tooling

Insertion Tools are designed for contacts crimped to small fragile wire. They are designed to stabilize the contact during insertion. For use of Insertion Tool 91002 which may be used with these contacts, refer to Instruction Sheet 408-7347. Extraction Tools are designed to release the locking lance inside the connector housing without damaging the housing or contacts. For use of Extraction Tool 305183 which may be used with these contacts, refer to Instruction Sheet 408-1216.

WIRE SIZE RANGE, AWG	INSULATION DIAMETER RANGE	HAND TOOL (DOCUMENT)	APPLICATOR (408-8040)	POWER UNIT (DOCUMENT)
30-26	1.02-1.52 [.040-.060]	91515-1 (408-8547)	466598-2	565435-5 (409-5128) 1338600-3, -4 (409-10016)
	0.36-0.76 [.014-.030]	90225-2 (408-7414)	466585-3	565435-5 (409-5128) 1338600-3, -4 (409-10016)
26-24	0.89-1.40 [.035-.055]	91515-1 (408-8547)	466321-3	122500-2, -3 (409-5852) 217500-1, -2 (409-5866) 356500-1, -2 (409-5878)
			466321-4	354500-1 (409-5842) 565435-5 (409-5128) 1338600-3, -4 (409-10016)
			466908-2	1320895-1, -3 (409-10012)

Figure 6 (cont'd)

WIRE SIZE RANGE, AWG	INSULATION DIAMETER RANGE	HAND TOOL (DOCUMENT)	APPLICATOR (408-8040)	POWER UNIT (DOCUMENT)
24-20	1.02-2.03 [.040-.080]	91505-1 (408-8547) 91515-1 (408-8547)	466323-3	122500-2, -3 (409-5852) 217500-1, -2 (409-5866) 356500-1, -2 (409-5878)
			466323-4	354500-1 (409-5842) 565435-5 (409-5128) 1338600-3, -4 (409-10016)
			466907-2	1320895-1, -3 (409-10012)
	2.03-2.54 [.080-.100]	90225-2 (408-7414) 91523-1 (408-8547)	466324-1	122500-2, -3 (409-5852) 217500-1, -2 (409-5866) 356500-1, -2 (409-5878)
			466324-2	354500-1 (409-5842) 565435-5 (409-5128) 1338600-3, -4 (409-10016)
			466942-1	1320895-1, -3 (409-10012)
	1.52-3.43 [.060-.135]	90331-1 (408-7773)	466383-4	354500-1 (409-5842) 565435-5 (409-5128) 1338600-3, -4 (409-10016)
			466979-1	1320895-1, -3 (409-10012)
			567363-1	122500-2, -3 (409-5852) 217500-1, -2 (409-5866) 356500-1, -2 (409-5878)
			567363-2	354500-1 (409-5842) 565435-5 (409-5128) 1338600-3, -4 (409-10016)
			567363-3	354500-1 (409-5842)
			567806-1	1320895-1, -3 (409-10012)
18-16	2.03-2.54 [.080-.100]	91505-1 (408-8547) 91523-1 (408-8547)	466325-1	122500-2, -3 (409-5852) 217500-1, -2 (409-5866) 356500-1, -2 (409-5878)
			466325-2	354500-1 (409-5842) 565435-5 (409-5128) 1338600-3, -4 (409-10016)
			466906-1	1320895-1, -3 (409-10012)
			466923-2	1320895-1, -3 (409-10012)
18-14	2.03-2.54 [.080-.100]	91519-1 (408-8547)	466326-3	122500-2, -3 (409-5852) 217500-1, -2 (409-5866) 356500-1, -2 (409-5878)
			466326-4	354500-1 (409-5842) 565435-5 (409-5128) 1338600-3, -4 (409-10016)
	2.79-3.81 [.110-.150]	91521-1 (408-8547)	567364-2	354500-1 (409-5842) 565435-5 (409-5128) 1338600-3, -4 (409-10016)
			466958-1	1320895-1, -3 (409-10012)

■See Instruction Sheet 408-8039.

Figure 6 (cont'd)

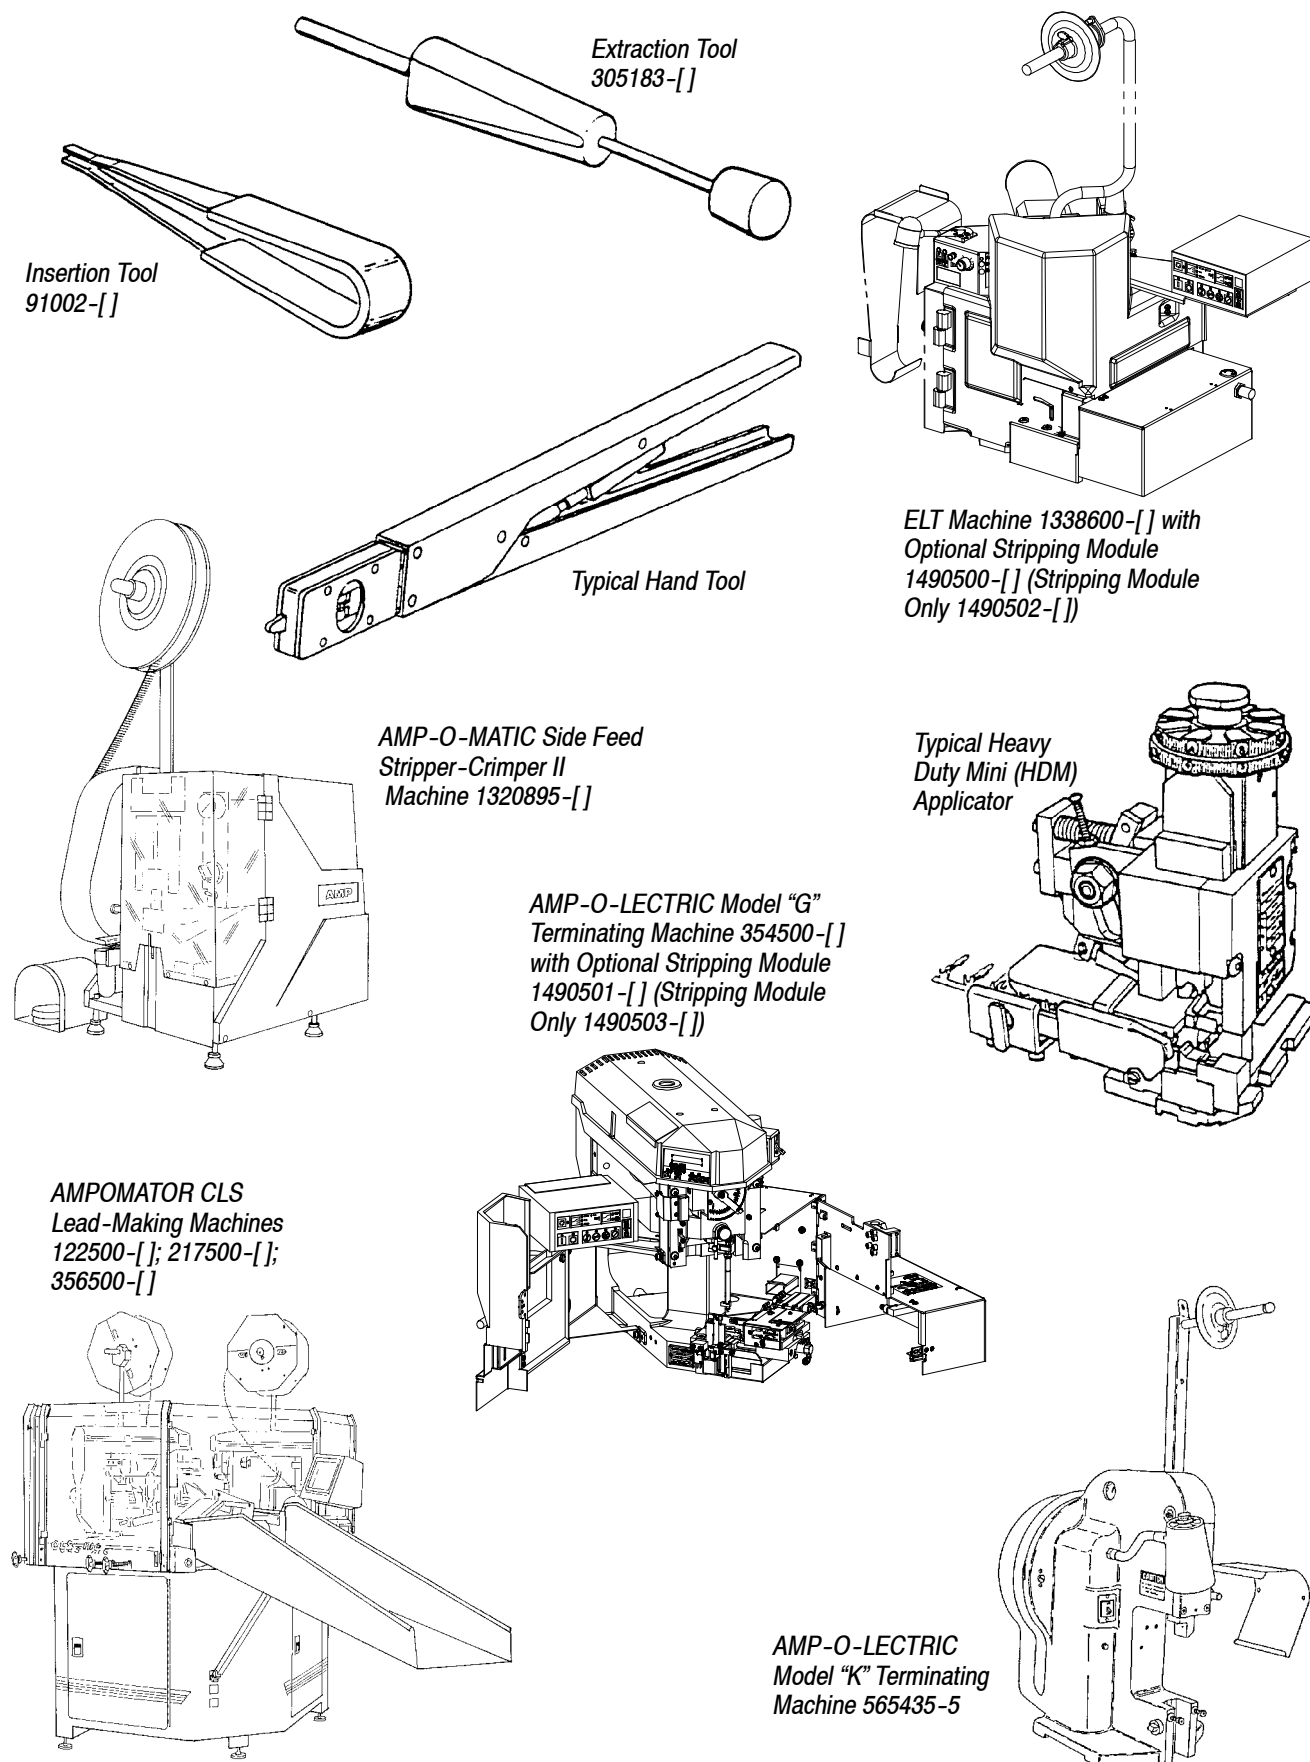


Figure 6 (end)

6. VISUAL AID

Figure 7 shows a typical application of a Type III+ (Size 16) Contact. This illustration should be used by production personnel to ensure a correctly applied product. Applications which DO NOT appear correct should be inspected using the information in the preceding pages of this specification and in the instructional material shipped with the product.

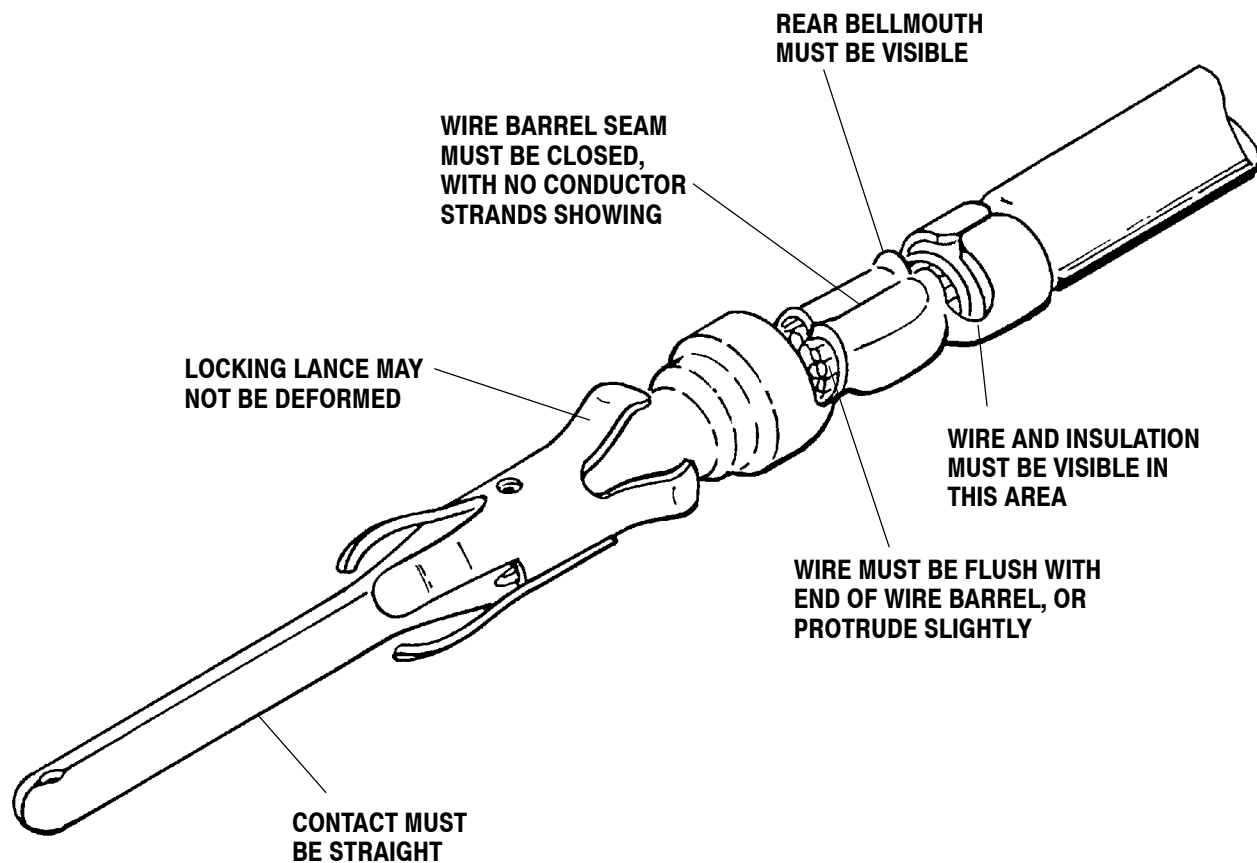


FIGURE 7. VISUAL AID

NOTE



All numerical values are in metric units [with U.S. customary units in brackets]. Dimensions are in millimeters [and inches]. Unless otherwise specified, dimensions have a tolerance of ± 0.18 [± 0.007] and angles have a tolerance of $\pm 3^\circ$. Figures and illustrations are for identification only and are not drawn to scale.

1. INTRODUCTION

This specification covers the requirements for application of Circular Plastic Connectors (CPC). The connectors are available in various shell sizes and standard or reverse sex configurations. The four series available include standard, high, and power density connectors, and a combination standard and power density connector. The CPC's are designed for use with various contacts. Applicable wire sizes range from 30 to 8 AWG and can be crimped with hand tools or by automatic machines.

When corresponding with Tyco Electronics Personnel, use the terminology provided on this specification to help facilitate your inquiry for information. Basic terms and features of components are provided in Figure 1.

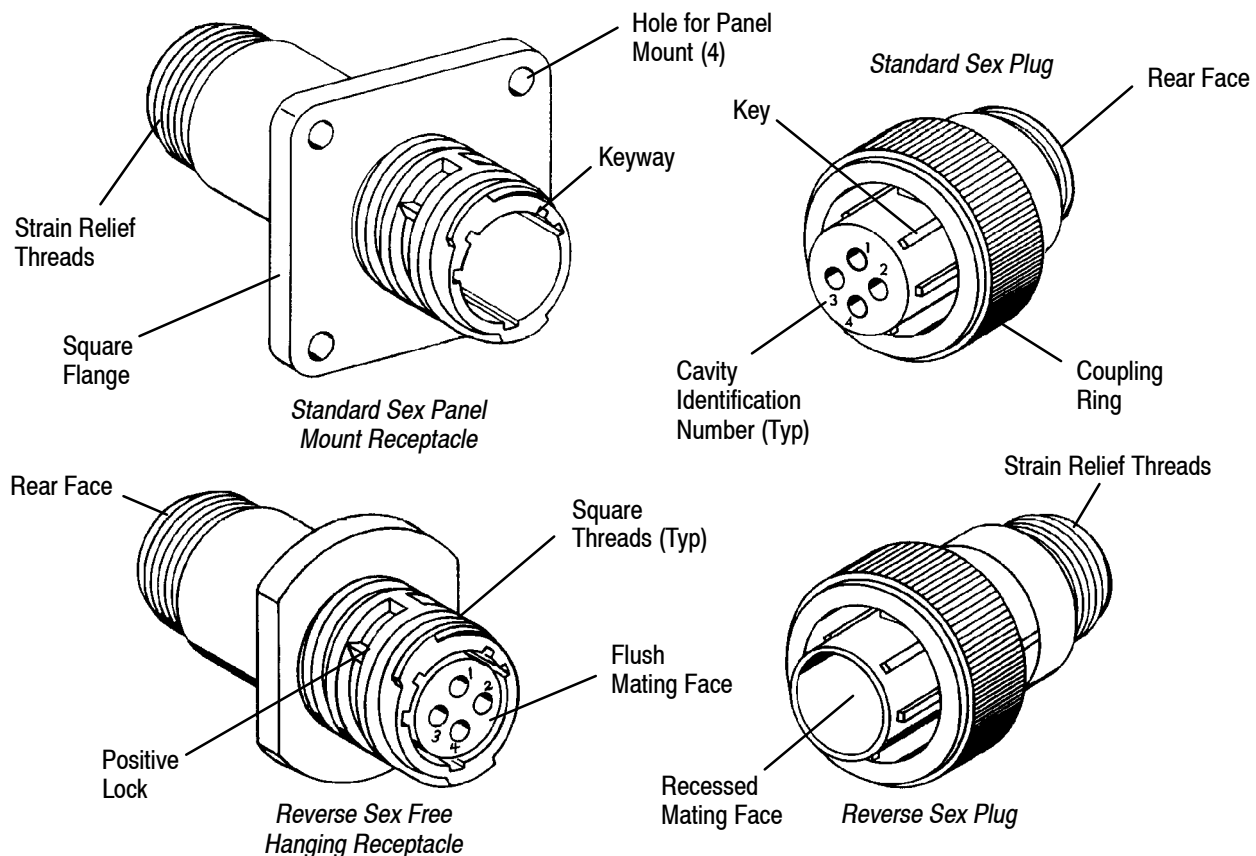


Figure 1

2. REFERENCE MATERIAL

2.1. Revision Summary

- Updated document to corporate requirements
- New format and logo
- Deleted obsolete tooling part numbers and related documents throughout
- Changed Figure 2 to Paragraph 2.5 and renumbered

2.2. Customer Assistance

Product Part Number 206060 and Product Code 5029 are representative of the Circular Plastic Connectors. Use of these numbers will identify the product line and expedite your inquiries through a service network established to help you obtain product and tooling information. Such information can be obtained through a local Tyco Electronics Representative or, after purchase, by calling the Product Information number at the bottom of page 1.

2.3. Drawings

Customer drawings for specific products are available from the service network. The information contained in the Customer Drawings takes priority if there is a conflict with this specification or with any technical documentation supplied by Tyco Electronics.

2.4. Specifications

Product Specifications provide performance test information. Application Specifications provide application requirements and reference materials.

Product Specifications:

108-10024 — CPC Connectors 108-10037 - Type XII Contacts

108-10042 — Type III+ Contacts 108-12011 - Subminiature COAXICON* Contacts

Application Specifications:

114-10000 — 20DF (Series 2) Contacts

114-10004 — Type III+ (Series 1) Contacts 114-10005 - Type XII (Series 3) Contacts

2.5. Instructional Material

The following list includes available instruction sheets (408-series) that provide assembly procedures for product, operation, maintenance and repair of tooling, as well as setup and operation procedures of applicators; and customer manuals (409-series) that provide setup, operation, and maintenance procedures of machines.

<u>Document Number</u>	<u>Document Title</u>
408-1216	Extraction Tools 3051183-[]
408-2024-2	Hand Crimping Tools 69656-[]
408-2024-3	Instruction/Maintenance/Inspection Sheet for Subminiature COAXICON* Contacts
408-2095	"C" Head Straight Action Hand Tool (SAHT) 69710-1
408-6510	Hand Crimping Tool 90384-1
408-6610	Hand Crimping Tool 90066-7 and Head Assembly 90066-9
408-6614	Hand Crimping Tool 90067-5
408-6695	Hand Crimping Tool 90405-1
408-6709	Hand Crimping Tool 90406-1
408-6736	Insertion Tool 211300
408-7276	Extraction Tool 91019-3
408-7347	Insertion Tools 91002-1, -2
408-7414	Hand Crimping Tool 90225-2
408-7508	Insertion/Extraction Tools 91067-1 and 91067-2
408-7516	Application Tooling for Screw-Machine Contacts
408-7521	Hand Crimping Tool 90265-1
408-7582	Accessories for Circular Plastic Connectors (CPC)
408-7593	Circular Plastic Connectors (CPC)
408-7773	Straight Action Hand Tool 90331-1 for Type III(+) Contacts
408-7799	AMPLIMITE* Solder Pot Contacts 66569-3 and 66570-3
408-7942	Hand Crimping Tool 90310-2
408-7954	Hand Crimping Tool 90374-1
408-8040	Heavy Duty Miniature Quick-Change Applicators (Side-Feed Type)
408-9404	Insertion/Extraction Tool 91285-1 and Replacement Tip Kits 543382-[]
408-9819	PRO-CRIMPER* III Hand Crimping Tool Assembly 58495-1


2.6. Manuals

Manual 402-40 is available upon request and can be used as a guide in soldering. This manual provides information on various flux types and characteristics along with the commercial designation and flux removal procedures. A checklist is included in the manual as a guide for information on soldering problems.

3. REQUIREMENTS

3.1. Mounting Holes and Panel Cutouts

Dimensions and layout for mounting holes and panel cutouts are shown in Figure 2.

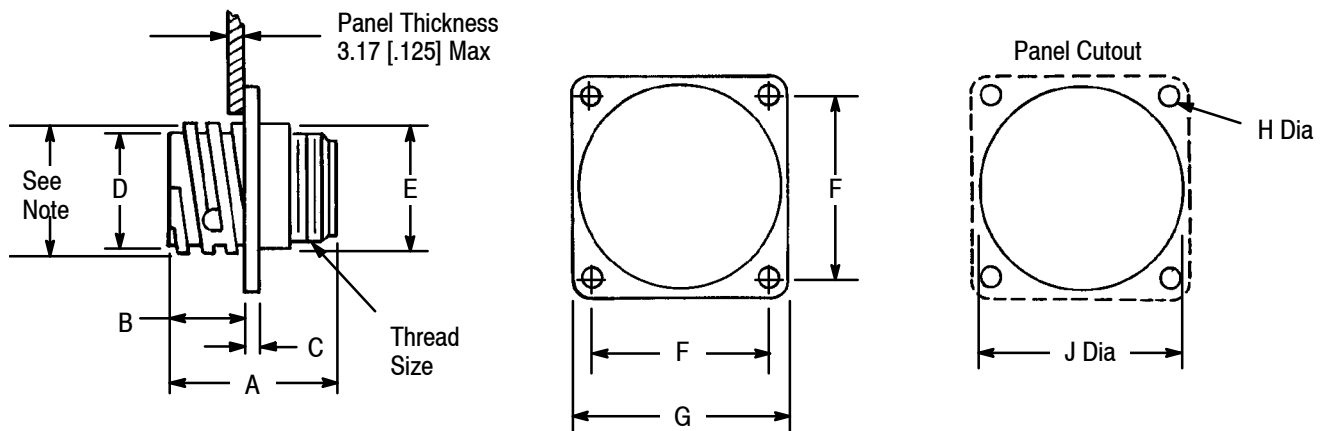

SERIES	ARRANGE- MENT NUMBER	SEX	A MAX	B ± 0.38 [.015]	C ± 0.25 [.010]	D ± 0.25 [.010]	E MAX	F ± 0.25 [.010]	G ± 0.64 [.025]	H $+0.18/0$ [+.007/0]	J	THREAD SIZE
Series 1	11-4	Rev	27.18 [1.070]	10.67 [.420]	2.39 [.094]	17.45 [.687]	18.80 [.740]	21.44 [.844]	28.58 [1.125]	3.18 [.125]	21.34 [.840]	5/8-24 UNEF-2A
		Std	34.29 [1.350]									
	13-9	Std	34.29 [1.350]	10.67 [.420]	2.39 [.094]	20.62 [.812]	22.33 [.879]	24.61 [.969]	32.54 [1.281]	3.18 [.125]	24.87 [.979]	3/4-20 UNEF-2A
	17-14	Rev	27.18 [1.070]	10.67 [.420]	2.39 [.094]	26.67 [1.050]	28.19 [1.110]	28.58 [1.125]	36.45 [1.435]	3.81 [.150]	30.73 [1.210]	15/16-20 UNEF-2A
	17-16	Std	34.29 [1.350]									
	23-24	Std	34.29 [1.350]	13.21 [.520]	3.96 [.156]	36.53 [1.438]	38.35 [1.510]	36.53 [1.438]	44.45 [1.750]	3.81 [.150]	40.89 [1.610]	1-3/8-18 UNEF-2A
Series 2	11-8	Std	27.18 [1.070]	10.67 [.420]	2.39 [.094]	17.48 [.688]	16.00 [.630]	21.44 [.844]	28.58 [1.125]	3.18 [.125]	21.34 [.840]	5/8-24 UNEF-2A
		Rev	20.55 [.809]									
	11-9	Std	20.55 [.809]	10.67 [.420]	2.39 [.094]	26.67 [1.050]	23.95 [.943]	28.58 [1.125]	36.45 [1.435]	3.81 [.150]	30.73 [1.210]	15/16-20 UNEF-2A
	17-28	Std	20.55 [.809]	10.67 [.420]	2.39 [.094]	26.67 [1.050]	23.95 [.943]	28.58 [1.125]	36.45 [1.435]	3.81 [.150]	30.73 [1.210]	15/16-20 UNEF-2A
		Rev	23.47 [.924]	10.67 [.420]	3.96 [.156]	36.53 [1.438]	38.48 [1.515]	36.53 [1.438]	44.45 [1.750]	3.81 [.150]	40.89 [1.610]	1-3/8-18 UNEF-2A
	23-57	Rev	23.47 [.924]	10.67 [.420]	3.96 [.156]	36.53 [1.438]	38.48 [1.515]	36.53 [1.438]	44.45 [1.750]	3.81 [.150]	40.89 [1.610]	1-3/8-18 UNEF-2A
	23-63	Std	23.47 [.924]	10.67 [.420]	3.96 [.156]	36.53 [1.438]	38.48 [1.515]	36.53 [1.438]	44.45 [1.750]	3.81 [.150]	40.89 [1.610]	1-3/8-18 UNEF-2A
	23-63	Std	23.47 [.924]	10.67 [.420]	3.96 [.156]	36.53 [1.438]	38.48 [1.515]	36.53 [1.438]	44.45 [1.750]	3.81 [.150]	40.89 [1.610]	1-3/8-18 UNEF-2A

Figure 2 (cont'd)

SERIES	ARRANGE- MENT NUMBER	SEX	A MAX	B ± 0.38 [.015]	C ± 0.25 [.010]	D ± 0.25 [.010]	E MAX	F ± 0.25 [.010]	G ± 0.64 [.025]	H $\pm 0.18/0$ [+.007/0]	J	THREAD SIZE
Series 3	17-3	Std	41.53 [1.635]	10.67 [.420]	2.39 [.094]	26.67 [1.050]	28.19 [1.110]	28.58 [1.125]	36.45 [1.435]	3.81 [.150]	30.73 [1.210]	15/16-20 UNEF-2A
	23-7	Rev	41.53 [1.635]	13.21 [.520]	3.96 [.156]	36.53 [1.438]	38.35 [1.510]	36.53 [1.438]	44.45 [1.750]	3.81 [.150]	40.89 [1.610]	1-3/8-18 UNEF-SA
Series 4	23-16M	Std	41.53 [1.635]	13.21 [.520]	3.96 [.156]	36.53 [1.438]	38.35 [1.510]	36.53 [1.438]	44.45 [1.750]	3.81 [.150]	40.89 [1.610]	1-3/8-18 UNEF-SA
	23-22M		41.53 [1.635]	13.21 [.520]	3.96 [.156]	36.53 [1.438]	38.35 [1.510]	36.53 [1.438]	44.45 [1.750]	3.81 [.150]	40.89 [1.610]	1-3/8-18 UNEF-SA

NOTE: The first number of the Arrangement Number represents the dimension (in sixteenths) over the threads; the number after the hyphen represents the number of circuits per connector.

Figure 2 (end)


3.2. Wire Size and Preparation

Jacketed or discrete wire may be used with this product. Jacketed cable will provide more protection from damage. Look for information on jacketed cable sealing kits in Instruction Sheet 408-7582.

Contacts are available for the wire sizes specified. Prepare wire for crimping by stripping insulation according to dimensions in Figure 3. DO NOT nick, scrape, or cut the stranded or solid wire conductor during stripping operation.

NOTE


When using twisted pair cable, one wire should be cut shorter than the other by the same distance as the strip length of the longer wire (E).

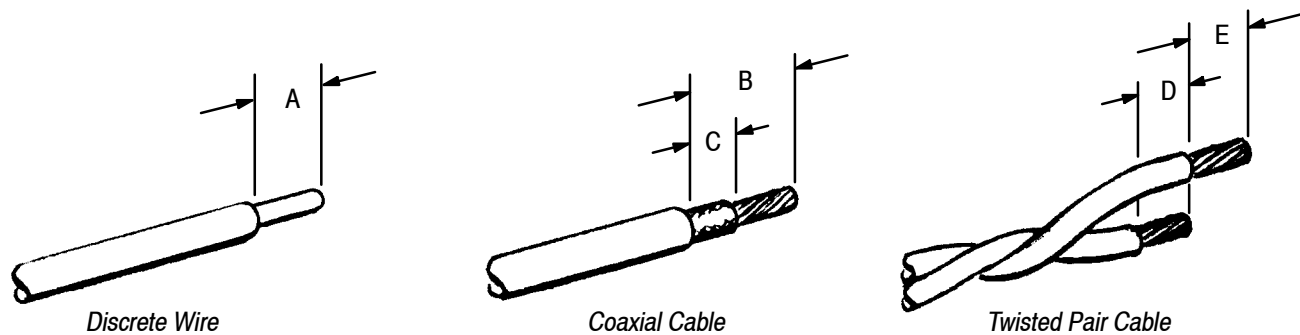

WIRE SIZE RANGE (AWG)	CONTACT TYPE		WIRE STRIP LENGTH
30-14	III+	Crimp Type	3.96 [.156] (A)
		Solder Type	
26-16		Solder Type (With Preformed Wire Barrel Insulation Support)	
24-20	20 DM (Screw Machine)		3.56 [.140] (A)
28-20	20 DF Precision Formed	With Insulation Support	2.54 [.100] (A)
		Without Insulation Support	2.77 [.109] (A)
28-20	20 DF (Solder Pot)		3.58 [.141] (A)
16-18	XIII		7.14 [.281] (A)
Coaxial Cable	Subminiature COAXICON		Cable Jacket 8.74 [.344] (B) Center Conductor 5.56 [.219] (C)
Twisted Pair 30-28			Short Wire 3.18 [.125] (D) Long Wire 5.56 [.219] (E)

Figure 3

3.3. Loading Contact into Housing

Normally an insertion tool is not required to insert contacts into housings. However, if the wire bundle is large or the individual wires are fragile, the use of an insertion tool is recommended. Refer to Section 5, TOOLING.

3.4. Shield and Strain Relief

If wire at the rear of the housing is subjected to strain, use of a strain relief will prevent damage to the contacts, wires, and housing.

A. Strain Relief Kits

Several types and sizes of strain relief kits are available. Shield and strain relief kits include a shield, strain relief clamps, and two self-tapping screws. They can be attached to the plug and/or receptacle of free-hanging or panel-mounted connectors. Flexible strain relief boots and grippers are used with jacketed cable (or firmly taped discreet wires) to provide wire protection and prevent contact pullout when severe cable-angle applications are encountered, or when connectors are frequently disconnected and reconnected. See Figure 4. Heat shrink sealing boots can also provide a splash-proof strain relief for jacketed cable. See Paragraph 3.4. B.

NOTE

If a strain relief is used on the connector, the wires may be dressed to an angle at the end of the strain relief. However, without use of a strain relief, the wires should not be dressed closer than 63.5 mm [2.50 in.] from the back of the housing. To prevent damage to contacts and/or housing, avoid exerting stress on wire.

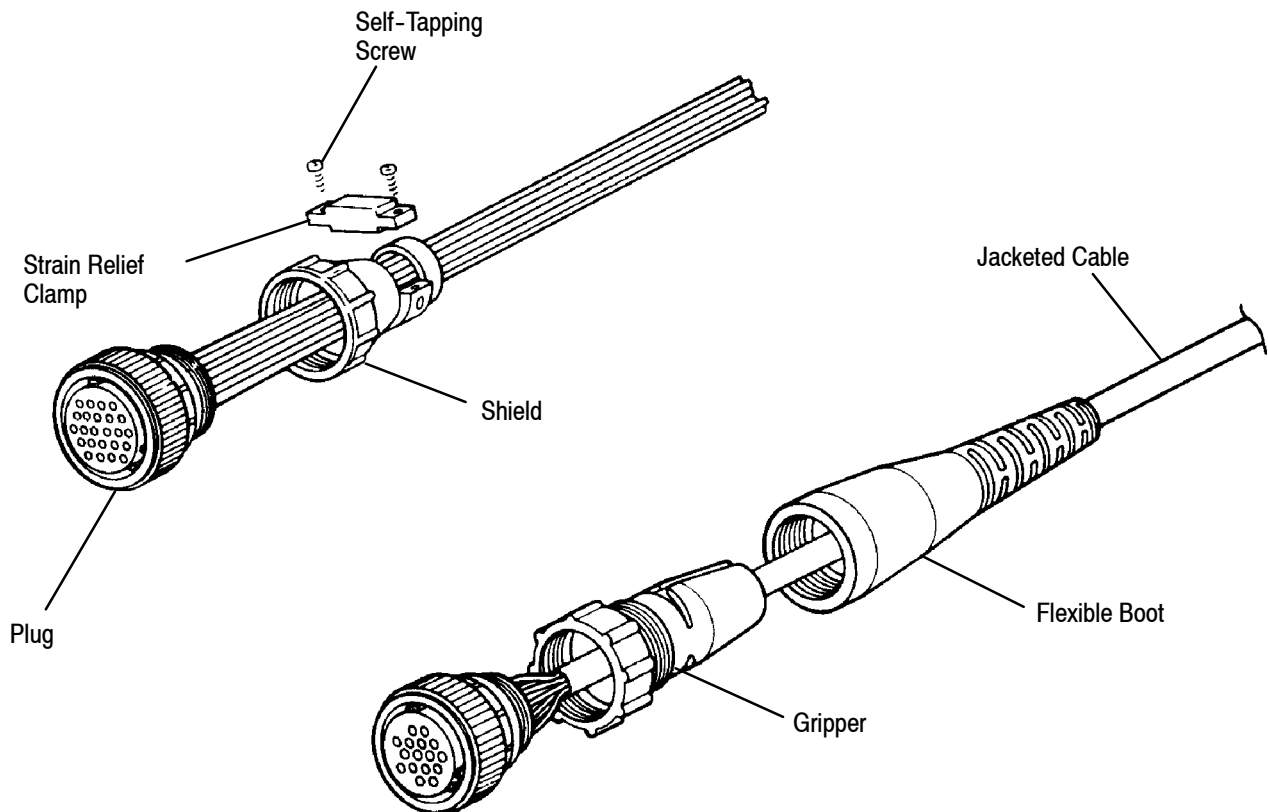
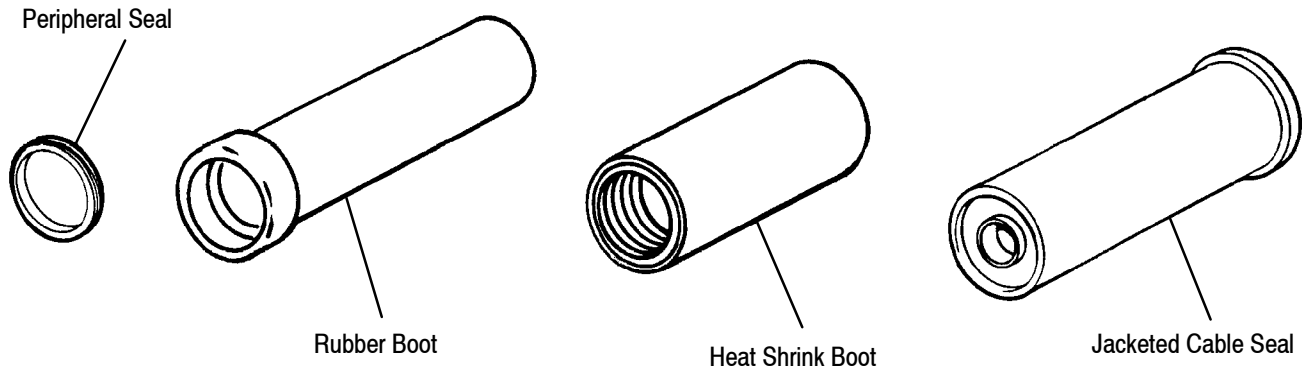



Figure 4

B. Boots and Seals (See Figure 5)

Rubber boots are available and can be used with jacketed cable to provide splash-proof connections for Series 1 and Series 3 connectors. Heat shrinkable sealing boots are available for use with jacketed cable. They will provide an environmentally sealed wire to-connector system and can be used with plugs or receptacles. A jacketed cable seal will also provide an environmentally sealed connection for jacketed cable. Peripheral seals (for receptacles only) are recommended for use in sealing splash-proof applications, or where connectors will be subject to vibration. Instruction material is included in shipments.

*Figure 5***C. Cable Bundle Tie- Off**

When no strain relief is used and wires need to be tied off, tie-off distance should be 50.8 mm [2.00 in.] minimum for up to 12 circuits and 76.2 mm [3.00 in.] minimum for 12 circuits or more. Supporting the cable with wire harness tie-off will avoid strain on the contact retention system, and will prevent contact back-out or failures. See Figure 6.

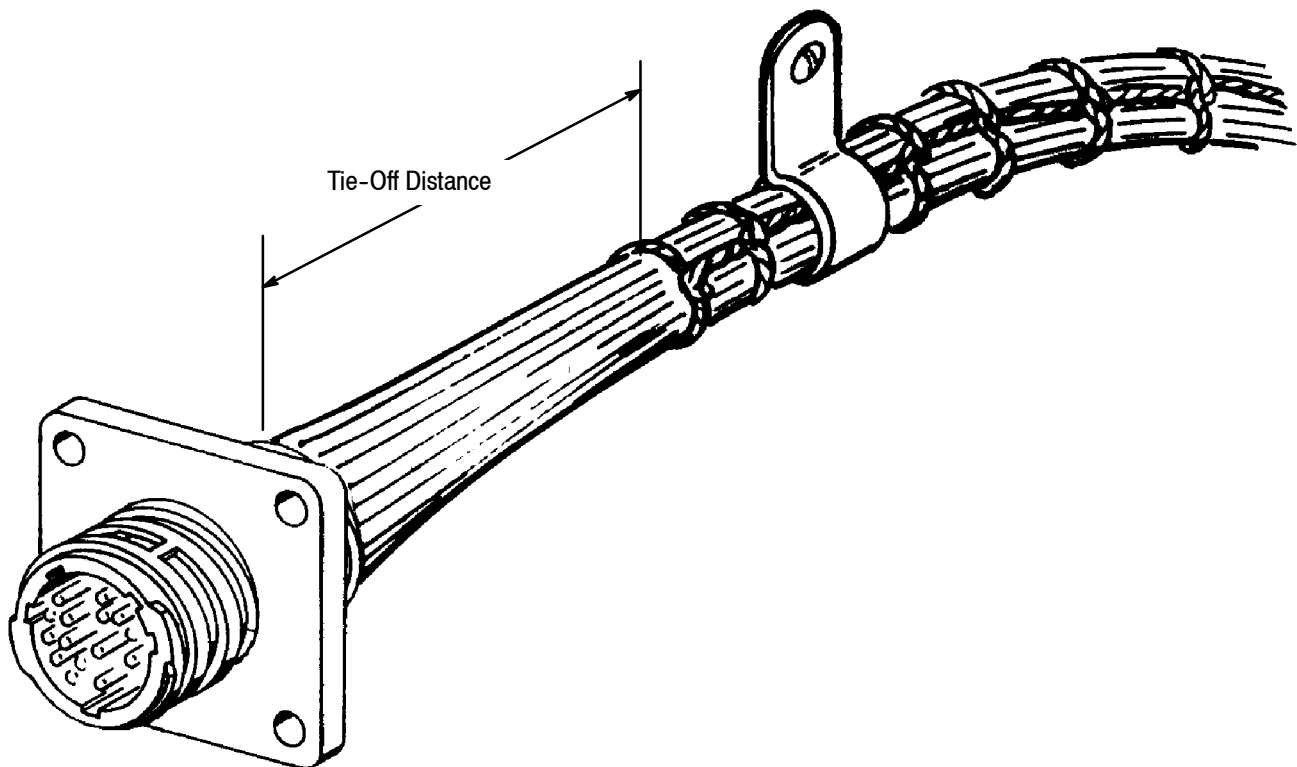*Figure 6*

3.5. Polarizing and Keying Features

A. Mating

To prevent accidental disengagement, the CPC's have a positive lock feature. They are designed with polarizing keys and keyways for easy alignment.

NOTE


Align polarizing keys and keyways and insert plug into receptacle; rotate coupling ring clockwise until positive lock snaps into position.

B. Keying Plugs

Use of keying plugs provides keying capabilities for all connector series. Keying plugs are used in socket cavities of standard sex plugs and reverse sex receptacles. They are available in three configurations. See Figure 7.

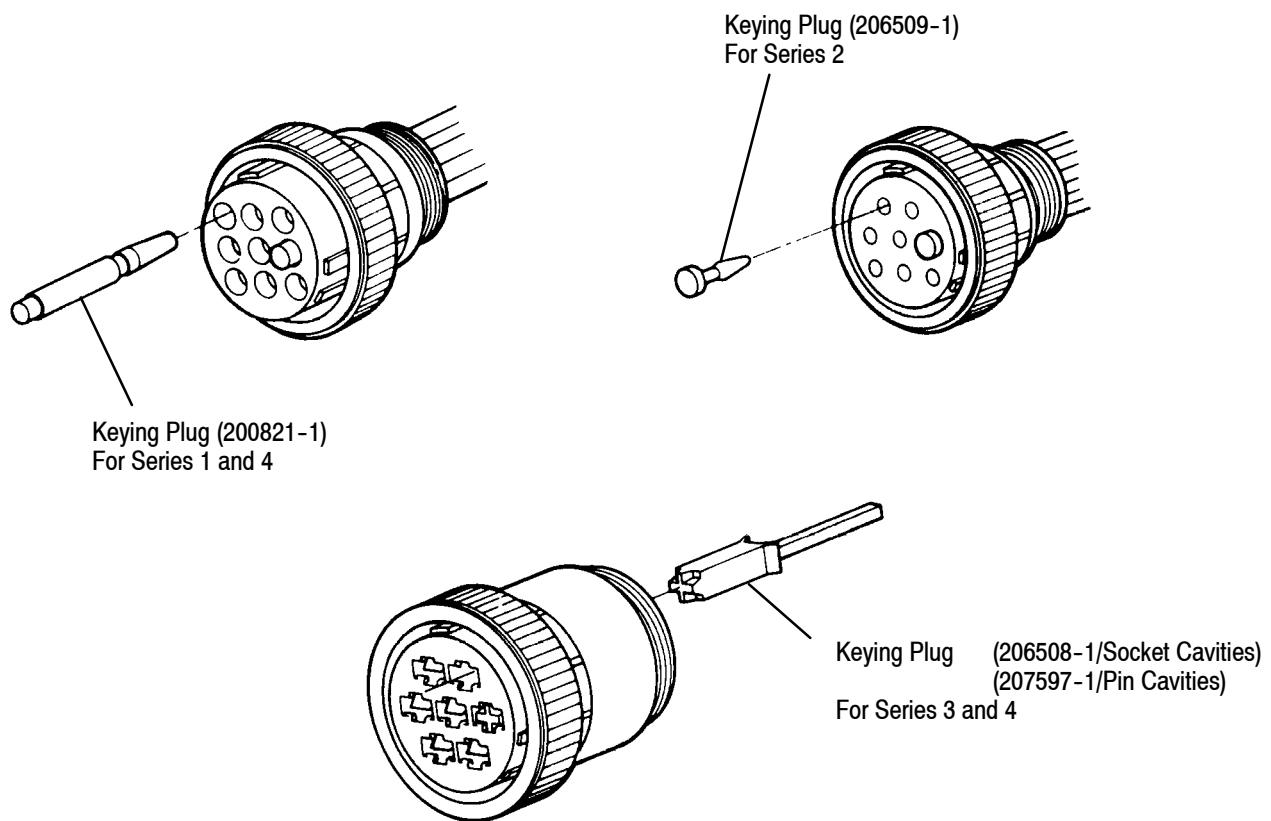


Figure 7

3.6. Contact Crimp Criteria

Contacts must be crimped to a designated height. Refer to the specific Application Specification for particular type of contacts.

3.7. Connector Application

Receptacle connectors are available with mounting flanges for front or rear panel-mount applications, and without flanges for free-hanging applications. Refer to Paragraph 2.5 for applicable instruction sheets on mounting connectors. Square flange receptacles which are pre-loaded with square posted contacts are available.

3.8. Soldering and Cleaning (Solder Pot Contacts Only)

A. Flux Selection

Solder pot contacts must be fluxed prior to soldering. Selection of flux must be compatible with the solder method used, and safety requirements.

B. Cleaning

Removal of fluxes, residues, and activators is mandatory. Cleaning procedures will depend on the type of flux used.

DANGER

Consideration must be given to toxicity and safety requirements recommended by the solvent manufacturer.

NOTE

Consult your local Tyco Electronics Representative for suitable cleaning solvents that can be used with these connectors.

C. Drying

When drying cleaned assemblies, make certain the temperature limitations of -55° to 105° C [-67° to 221° F] are not exceeded. Excessive temperatures may cause housing degradation.

D. Soldering Guidelines

Refer to Paragraph 2.6. for instruction material that is available for establishing soldering guidelines.

3.9. Repair

CAUTION

Care must be exercised to prevent damage to coupling rings of free-hanging connectors.

A. Coupling Ring Replacement

In the event it becomes damaged, the coupling ring, an integral part of the plug housing, can be replaced. Look for instruction sheet information under Paragraph 2.5 of this document.

B. Contacts

Crimped wire contacts as well as solder pot contacts are repairable. Find instructions in applicable Instruction Sheet listed in Paragraph 2.5.

4. QUALIFICATIONS

The Circular Plastic Connector is Recognized in the Component Program of Underwriters Laboratories Inc. (UL), for 250-Volt service, File No. E28476. Each CPC Assembly has a UL flammability rating of 94 V-1. They are CSA International Certified in File No. LR7189. Some connectors are recognized for 600-Volt service. Consult Tyco Electronics for more details.

5. TOOLING

Hand crimping tools and applicators are available for applying crimp type contacts, also Insertion tools and extraction tools assist in assembly and repair. Instruction Sheets describing tool operations, are packaged with the tool. See Figure 8.

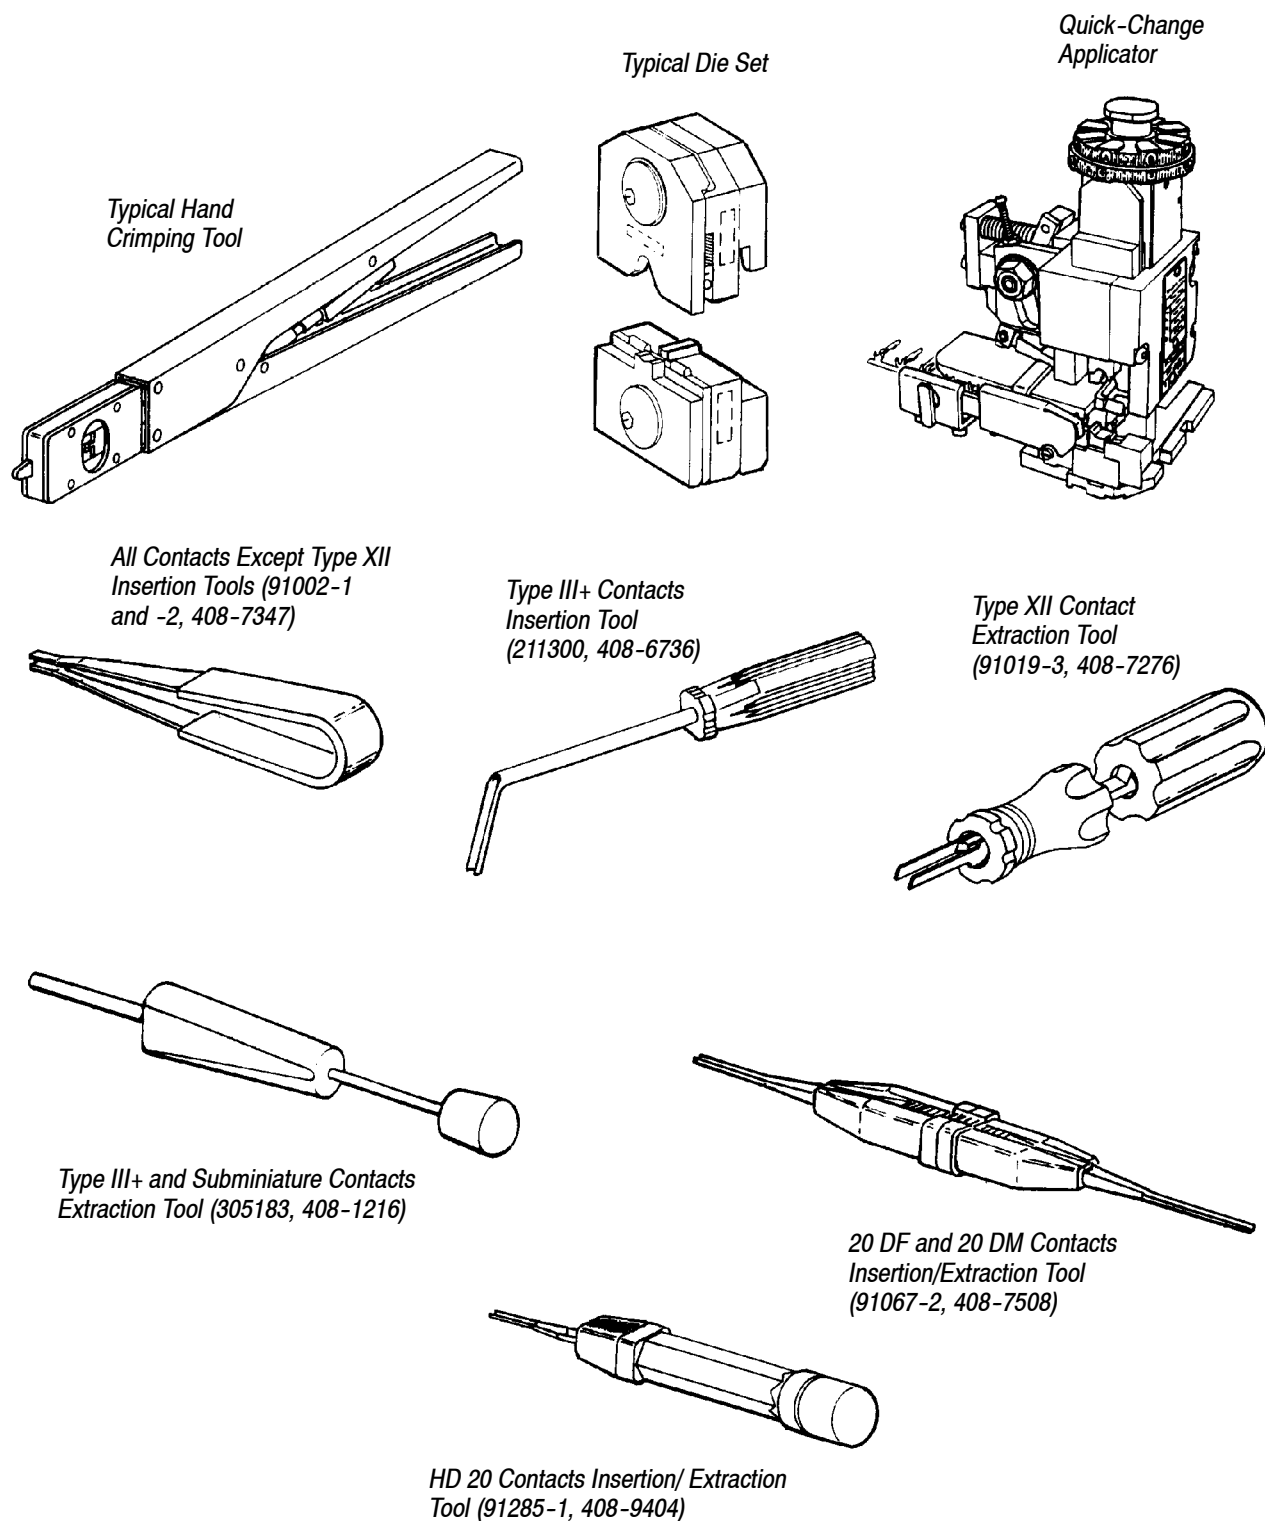


Figure 8 (cont'd)

CONTACT TYPE	WIRE SIZE RANGE (AWG)	TOOLING (DOCUMENT)		
		HAND TOOL	APPLICATOR (408-8040)	POWER UNIT GROUPS■
III+	30-20	90066-7 (408-6510)	466598-2	K
		90225-2 (408-7414)	466585-3	K
	26-24	---	466321-4	K
		---	466908-2	S
	24-20	---	466323-4	K
		---	466907-2	S
		---	466324-2	K
		---	466942-1	S
		---	466383-2	K
	24-16	90067-4 (408-6613)	---	---
		90067-5 (408-6614)	---	---
	18-16	---	466325-2	K
		---	466906-1	S
	18-14	90310-2 (408-7942)	466752-2	K
		90310-3 (408-9387)	466958-1	S
		---	466326-4	K
		---	466923-2	S
20 DF	28-24	90312-1 (408-7694)	466423-1	O
		90374-1 (408-7954)	466423-2	K
		90265-1 (408-7521)	466506-2	K
		---	466903-1■	S
		---	466901-1	S
		---	466758-1	O
		---	466758-2	K
		---	466963-1	S
	26-22	90406-1 (408-6709)	567036-1	O
		---	567036-2	K
	24-20	---	466422-1	O
		---	466422-2	K
		---	466900-1	S
		---	466505-1	O
		---	466505-2	K
		---	466902-1■	S
	22-18	90405-1 (408-6695)	567033-1	O
		---	567033-2	K
20 DM	24-20	601966-1 (408-7516)	599406-7▲	---

■Contact the Tooling Assistance Center number at the bottom of page 1 for available power units for the specific applicators

■Stripper/Crimper Applicator

▲AMP-TAPEMATIC* Stripper/Crimper Machine Requiring a Funnel

Figure 8 (cont'd)

CONTACT TYPE	WIRE SIZE RANGE (AWG)	TOOLING (DOCUMENT)		
		HAND TOOL	APPLICATOR (408-8040)	POWER UNIT GROUPS■
XII	16	90145-2 (408-7175)	---	---
	16-12	90382-2 (408-6561)	567455-2	K
		---	567455-1	O
	14-12	90145-1 (408-7175)	---	---
	10-8	90140-1 (408-7175)	567021-2	K
		90384-1 (408-6510)	---	---
Subminiature COAXICON	28 Twisted Pair (Solid)	69690 (408-2024-3)	---	---
	26 Twisted Pair (Solid or Stranded)		---	---
	28 Twisted Pair (Stranded)	69690-1 (408-2024-3)	---	---
		69690-2 (408-2024-3)	---	---
	30 Twisted Pair (Solid)	69690-2 (408-2024-3)	---	---
		69710-1 (408-2095)	---	---

■Contact the Tooling Assistance Center number at the bottom of page 1 for available power units for the specific applicators.

Figure 8 (end)

6. VISUAL AID

Figure 9 shows a typical application of Circular Plastic Connectors. This illustration should be used by production personnel to ensure a correctly applied product. Applications which DO NOT appear correct should be inspected using the information in the preceding pages of this specification and in the instructional material shipped with the product or tooling.

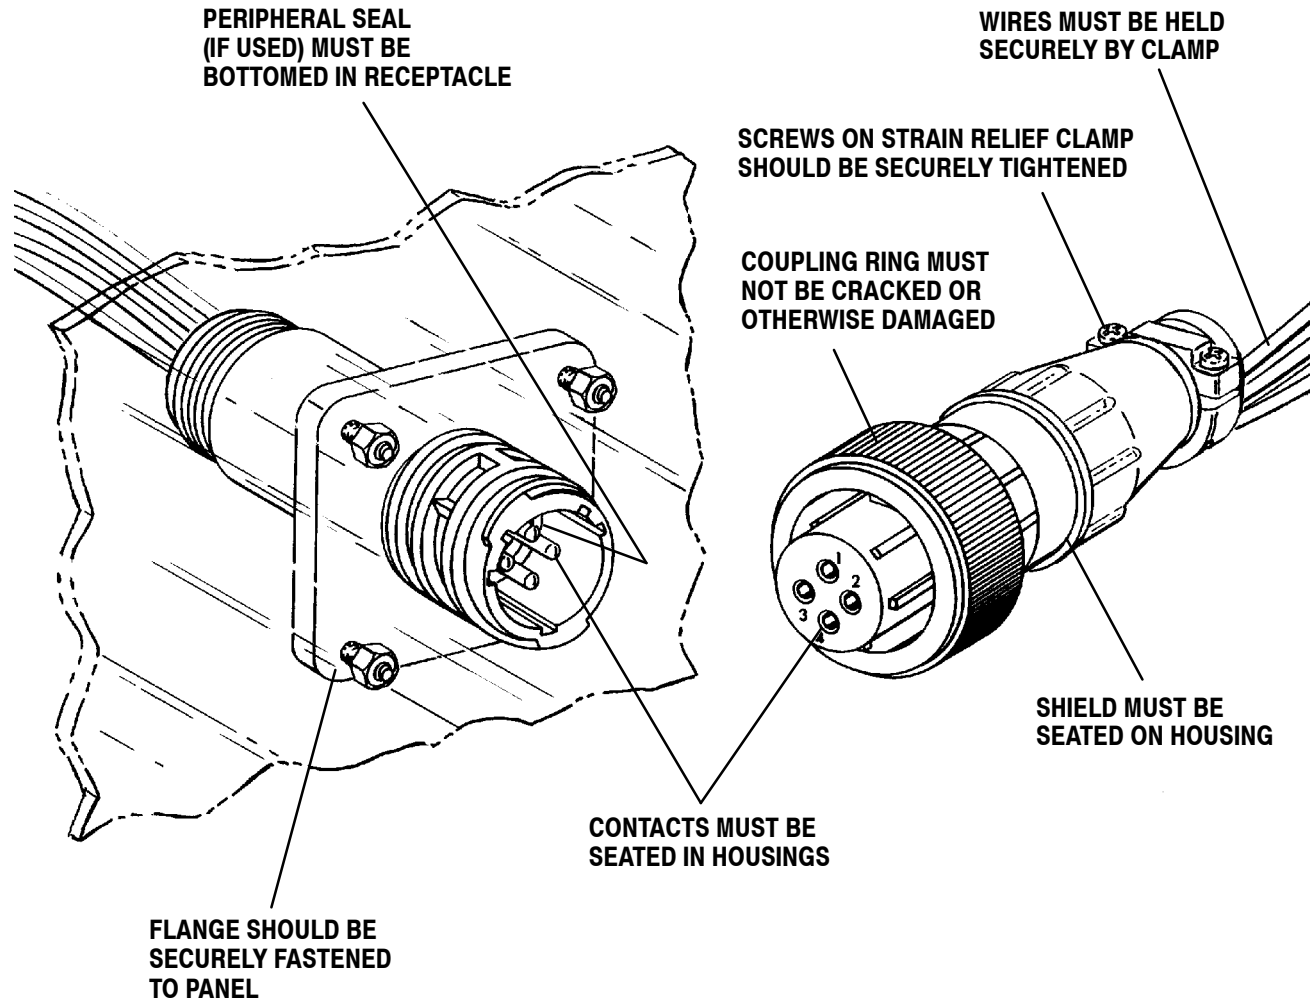


FIGURE 9. VISUAL AID