

# N25 DIGITAL PANEL METERS

## FEATURES:

- IP65
- Program LPConfig
- PD14 Programmer
- Linear char.




- Destined for measurement of d.c. voltage or d.c. current, temperature through Pt100 resistance thermometers, J, K thermocouples, a.c. voltage and a.c. current.
- 5 LED digit displays with 14 mm digit high.
- Parameters programmable by PD14 programmer:
  - precision of displayed results (decimal point),
  - measurement averaging time,
  - recounting of indications (individual characteristic),
  - automatic or manual compensation: cold junction temperature for measurement with thermocouples or wire resistance for measurement with Pt100 (N25T).

## INPUTS:

- AC
- DC
- Temperature Pt100 probe
- shunt
- 60 mV
- Current
- a.c. current transformer
- 20...20 mA
- 10...10 V
- 60 mV

## EXAMPLE OF APPLICATION

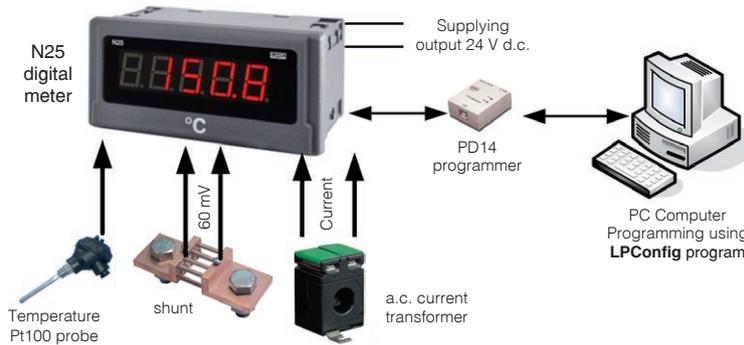

- Measurement and display:
- temperature
  - analog signals
  - d.c. current and voltage
  - rms current and voltage.

## OUTPUTS:



## GALVANIC ISOLATION:

- PD14 Programmer
- Sup.

Export department:  
+48 68 45 75 139/276/  
305/386  
Fax: +48 68 32 54 091  
e-mail: export@lumel.com.pl

„LUMEL” S.A.  
ul. Słubicka 1  
65-127 Zielona Góra  
POLAND  
[WWW.LUMEL.COM.PL](http://WWW.LUMEL.COM.PL)

## INPUTS

Type	Measuring ranges	Parameters	Overloads	Errors
N25S	-11 mV...-10 mV...60 mV...66 mV	Input resistance >1 MΩ	Short duration overload (1s): - voltage input: 10 Un - current input: 5 In Sustained overload: 110% Un, 110% In	<b>Basic error:</b> ± (0.2% of range + 1 digit) <b>Additional error</b> from ambient temperature changes: ± (50% of basic error/10K)
	-66 mV...-60 mV...60 mV...66 mV			
	-0.5 V...0 V...10 V...11 V			
	-11 V...-10 V...10 V...11 V			
	-1 mA...0 mA...20 mA...22 mA			
N25T	3.6 mA...4 mA...20 mA...22 mA	Input resistance 10 Ω ±1%	Short duration overload (1s) Input of sensors: 30 V	<b>Basic error:</b> ± (0.2% of range + 1 digit) <b>Additional errors:</b> • compensation of cold junction temperature changes: ± 0.2% of range, • from ambient temperature changes: ± (50% of basic error/10K).
	Pt100	Current flowing through the sensor: < 300 μA. Resistance of wires connecting RTD with the meter: - max 5 Ω (per wire) for automatic compensation - max 10 Ω (per wire) for manual compensation		
	Pt100	-50°C...150°C		
	Pt100	-50°C...400°C		
	Thermo-couple J	-50°C...1200°C		
N25Z	Thermo-couple K	-50°C...1370°C	Short term overload (1s): voltage input: 2 Un (< 1000V), current input: 10 In Sustained overload: 150% Un (for 400 V input), 120% (for remaining inputs), 120% In	<b>Basic error:</b> • voltage and current: ± (0.5% of range + 1 digit) in frequency range 20...500 Hz • frequency: ± (0.02% of range + 1 digit) <b>Additional error</b> from ambient temperature changes: ± (50% of basic error/10K)
	1...100...120 V a.c.	Input resistance > 2 MΩ		
	2.5...250...300 V a.c.			
	4...400...600 V a.c.			
	20...500 Hz (in voltage range: 24...480 V)			
0.01...1...1.2 A a.c.	Input resistance 10 mΩ ±10%			
N25H	0.05...5...6 A a.c.	Input resistance 2 mΩ ±10%	Short term overload (1s): voltage input: 2 Un (< 1000V), current input: 10 In Sustained overload: 150% Un (for ± 400 V input), 120% (for remaining inputs), 120% In	<b>Basic error:</b> ± (0.2% of range + 1 digit) <b>Additional error</b> from ambient temperature changes: ± (50% of basic error/10K)
	0...100...110 V d.c.	Input resistance > 2MΩ		
	0...250...275 V d.c.			
	-120...-100...100...120 V d.c.			
	-300...-250...250...300 V d.c.			
-600...-400...400...600 V d.c.				
N25H	-1.2...-1...1...1.2 A d.c.	Input resistance 10 mΩ ±10%		
	-6...-5...5...6 A d.c.	Input resistance 2 mΩ ±10%		

## OUTPUTS

For N25S and N25T	Output for supply external transducers	24 V ± 5%, 30 mA
-------------------	--	------------------

### EXTERNAL FEATURES

Weight	< 0.25 kg	
Overall dimensions	96 x 48 x 64 mm with terminals	
Protection grade (acc. to EN 60529)	ensured by the housing: IP65	from the terminal side: IP 20
Display	5-digit LED display, 14 mm high, red colour	indication range: -19999...99999

### RATED OPERATING CONDITIONS

Supply voltage	230 V ± 10% a.c. (45...65 Hz); 110 V ± 10% a.c. (45...65 Hz) 24 V ± 10% a.c. (45...65 Hz); 85...253 V a.c. (40...400 Hz) or d.c.; 20...40 V a.c. (40...400 Hz) or d.c.	input power consumption: 6 VA
Temperature	ambient: -10...23...55 °C	storage: -25...85 °C
Relative humidity	≤ 95%	condensation inadmissible
Operating position	any	
Preheating time	30 min	
Averaging time	≥ 0.5 s	1 second default set

### SAFETY AND COMPATIBILITY REQUIREMENTS

Electromagnetic compatibility	noise immunity	acc. to EN 61000-6-2
	noise emissions	acc. to EN 61000-6-4
Isolation between circuits	basic	acc. to EN 61010-1
Pollution grade	2	
Installation category	III (for the 400 V option - category II)	
Maximal phase-to-earth operating voltage	for supply circuits: 300 V, for measuring circuits: 600 V - cat. II	
	for other circuits: 50 V	
Altitude above sea level	< 2000 m	

### CONNECTION DIAGRAMS




Fig. 1. Electrical connections of the N25S meter






Fig. 2. Electrical connections of the N25T meter



Resistance thermometer in a two-wire system with manual compensation  
Resistance thermometer in a three-wire system with automatic compensation

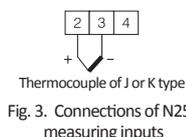

Thermocouple of J or K type  
Fig. 3. Connections of N25T measuring inputs




Fig. 4. Electrical connections of N25Z and N25H meters for the measurement of voltage (and frequency only in N25Z)




Fig. 5. Electrical connections of N25Z i N25H meters for the current measurement

### ORDERING

TABLE 1. ORDERING CODES:

	N25 -	X	X	X	XX	XX	X	X
<b>Input kind:</b>								
standard: voltage, current		S						
temperature: thermocouples, resistance thermometers		T						
a.c. signals		Z						
d.c. signals: high voltage and high current		H						
<b>Input:</b>								
see table 2			X					
<b>Supply:</b>								
230 V a.c.								1
110 V a.c.								2
24 V a.c.								3
85...253 V a.c./d.c. with supply output 24 V/30 mA*								4
20...40 V a.c./d.c. with supply output 24 V/30 mA*								5
<b>Unit:</b>								
see table 3					XX			
<b>Version:</b>								
standard								00
non-standard settings								NS
custom-made**								XX
<b>Language:</b>								
Polish								P
English								E
other**								X
<b>Acceptance tests:</b>								
without extra requirements								0
with an extra quality inspection certificate								1
acc. to customer's request**								X

\* - the output is only in N25S and N25T meters  
\*\* - after agreeing with the manufacturer

TABLE 2. INPUT SIGNALS

Nr	N25S	N25T	N25Z	N25H
1	0...20 mA	Pt100: -50...150 °C	100 V a.c.	±100 V d.c.
2	4...20 mA	Pt100: -50...400 °C	250 V a.c.	±250 V d.c.
3	0...60 mV	Thermocouple J	400 V a.c.	±400 V d.c.
4	0...10 V	Thermocouple K	1 A a.c.	±1 A d.c.
5	± 60 mV		5 A a.c.	±5 A d.c.
6	± 10 V		20...500 Hz	0...100 V d.c.
7				0...250 V d.c.

TABLE 3. CODES OF PRINTED UNITS:

Code	Unit	Code	Unit	Code	Unit
00	without unit	06	mA	12	bar
01	°C	07	kA	13	kPa
02	%	08	kV	14	MPa
03	A	09	Hz		
04	V	10	turns	XX	on order
05	mV	11	rpm		

TABLE 4. EXAMPLE OF NON-STANDARD SETTINGS:

Parameter	Range/Value
Decimal point	000,0 for I, U
Averaging time	1 s
Upper measurement overflow	99999
Lower measurement overflow	-19999
Individual characteristic	enabled
Parameter a of the individual characteristic	5
Parameter b of the individual characteristic	0

**Order example 1 :**

The code **N25Z-2 1 04 00 E 0** means:  
**N25Z** - digital meter for a.c. signals  
**2** - input: 250 V a.c.  
**1** - supply: 230 V a.c.  
**04** - unit: V  
**00** - standard version  
**E** - English language  
**0** - without extra requirements

**Order example 2 :**

The code **N25S-1 4 02 E 1** means:  
**N25S** - digital meter for d.c. signal  
**1** - input: 0...20mA  
**4** - supply: 85...253 V a.c.  
**02** - unit: %  
**NS** - non-standard settings, display range: 0...100.0  
**E** - English language  
**1** - with an extra quality inspection certificate

### SEE ALSO:



Free LPConfig software for easy programming of LUMEL's products. Available on our website



PD14 programmer - unit for programming LUMEL's products, with USB connection, LPCon compatible.



N30 digital panel meters with three-colour display.

### OUR OFFER



www.lumel.com.pl

For more information about LUMEL's products please visit our website: [www.lumel.com.pl](http://www.lumel.com.pl)

**Export department:**  
+48 68 45 75 139/276/  
305/ 386  
**Fax:** +48 68 32 54 091  
**e-mail:** [export@lumel.com.pl](mailto:export@lumel.com.pl)

„LUMEL” S.A.  
ul. Słubicka 1  
65-127 Zielona Góra  
POLAND  
**WWW.LUMEL.COM.PL**